

WESTCHESTER TOWNSHIP MUSEUM

WINDOW REHABILITATION

Window / Door Schedule
Westchester Township History Museum

Mark	Description
1	East Elevation - First Floor - restore per section 086.10
2	East Elevation - First Floor - part of a double window - restore per section 086.10
3	East Elevation - First Floor - part of a double window - restore per section 086.10
4	East Elevation - First Floor - restore per section 086.10
5	East Elevation - First Floor - restore per section 086.10
6	East Elevation - First Floor - a more recent window - remove storm and clean storm and window - prep and paint window surround&trim
7	East Elevation - First Floor - a more recent window - remove storm and clean storm and window - prep and paint window surround&trim
8	East Elevation - First Floor - a more recent window - remove storm and clean storm and window - prep and paint window surround&trim
B-1	East Elevation - Basement - restore per section 086.10
B-2	East Elevation - Basement - restore per section 086.10
9	South Elevation - First Floor - restore per section 086.10
10	South Elevation - First Floor - restore per section 086.10
11	South Elevation - First Floor - restore per section 086.10
12	South Elevation - First Floor - restore per section 086.10
13	South Elevation - First Floor - restore per section 086.10 - note storm sash bottom rail requires replacement
14	West Elevation - First Floor - a more recent window - remove storm and clean storm and window - prep and paint window surround&trim
15	West Elevation - First Floor - a more recent window - remove storm and clean storm and window - prep and paint window surround&trim
16	West Elevation - First Floor - a more recent window - remove storm and clean storm and window - prep and paint window surround&trim
17	West Elevation - First Floor - a more recent window - remove storm and clean storm and window - prep and paint window surround&trim
18	West Elevation - First Floor - restore per section 086.10
19	West Elevation - First Floor - restore per section 086.10
20	West Elevation - First Floor - restore per section 086.10
21	West Elevation - First Floor - restore per section 086.10
22	North Elevation - First Floor - restore per section 086.10
23	North Elevation - First Floor - restore per section 086.10
24	East Elevation - Second Floor - restore per section 086.10
25	East Elevation - Second Floor - restore per section 086.10
26	East Elevation - Second Floor - restore per section 086.10
27	East Elevation - Second Floor - half round fixed window restore per section 086.10 - no storm window
28	South Elevation - Second Floor - restore per section 086.10
29	South Elevation - Second Floor - restore per section 086.10
30	South Elevation - Second Floor - pair of French wood storm doors - restore per section 086.10, clean and do not paint hardware
31	South Elevation - Second Floor - restore per section 086.10
32	South Elevation - Second Floor - restore per section 086.10
33	South Elevation - Second Floor - restore per section 086.10
34	West Elevation - Second Floor - half round fixed window restore per section 086.10 - no storm window
35	West Elevation - Second Floor - restore per section 086.10
36	West Elevation - Second Floor - restore per section 086.10
37	North Elevation - Second Floor - restore per section 086.10
38	North Elevation - Second Floor - restore per section 086.10
39	East Elevation - Attic Level - triangular multi-lite window - restore per section 086.10
40	West Elevation - Third Floor - set of three windows with transoms and decorative molding / surrounds - restore per section 086.10 - carefully evaluate and document deterioration at roof joint and restore / replace damaged materials
41	West Elevation - Attic Level - triangular multi-lite window - restore per section 086.10
42	North Elevation - Third Floor - shed dormer with three windows - restore per section 086.10 - carefully evaluate and document deterioration at roof joint and restore / replace damaged materials

Doors	
A	East Elevation - First Floor - remove storm door, clean, sand, prep and paint storm door, door, frame, and trim
B	East Elevation - First Floor - more recent steel door, clean, sand, prep and paint door, frame, and trim
C	East Elevation - Third Floor - French Door to sleeping balcony - restore similar to section 086.10 Note: Balcony railing and decorative brackets will require new infill for missing historic trim, repair, and then preparation for paint
D	South Elevation - First Floor - remove storm doors, clean, sand prep and paint and re-install, sand prep and paint doors, frame, and trim
E	North Elevation - First Floor -clean, sand, prep, and paint door, frame and trim, carefully examine base of door / trim and threshold and repair and restore damaged materials

SHEET INDEX

- A2.0 COVER SHEET AND SCHEDULE
- A2.1 EAST ELEVATION NOTES
- A2.2 SOUTH ELEVATION NOTES
- A2.3 WEST ELEVATION NOTES
- A2.4 NORTH ELEVATION NOTES



THIS IS AN ORIGINAL DESIGN, CREATED BY SRKM ARCHITECTURE, INC. IT IS SUBMITTED FOR USE IN THIS PROJECT AND IS UNDER THE PROTECTION AND CONTROL OF THE ARCHITECT. ANY OTHER USE OR REPRODUCTION OF THIS INFORMATION WITHOUT THE WRITTEN CONSENT OF SRKM ARCHITECTURE, INC. IS PROHIBITED. SRKM ARCHITECTURE, INC. 120 SOUTH BURNING WATSON, IN 46360

REVISION:

COVER SHEET AND SCHEDULE
WESTCHESTER TOWNSHIP MUSEUM
700 W PORTER, CHESTERTON, IN

PROJECT No.	2015-031
DRAWN BY:	DDB
CHECKED BY:	JLK/BAM
DATE	SEPTEMBER 2015
SHEET No.	A2.0



120 SOUTH BURNING WATSON, IN 46360
PHONE 574.838.1586
WWW.SRKMARCH.COM


PROJECT NOTE:
WOOD COMPONENTS HAVE DETERIORATED BEYOND REPAIR IN A NUMBER OF LOCATIONS AND SHALL BE REPLACED WITH NEW COMPONENTS OF POPLAR OF DIMENSIONS TO MATCH EXISTING EXACTLY. NOMINAL SIZE LUMBER SHALL NOT BE ACCEPTABLE.

FLOOR PLAN KENNOTES:


- 1
- EXISTING WINDOW CONSISTS OF HISTORIC FRAMES AND SASHES WITH WOOD STORM WINDOW. REMOVE WOOD STORM WINDOW, CLEAN, PREP, AND REPAINT OFF SITE AND REINSTALL. CLEAN, PREP AND REPAINT HISTORIC FRAMES, WINDOW SASHES, SILLS, TRIM, AND STOOLS. SEE DIVISION EIGHT SPECIFICATIONS FOR SPECIFIC DETAIL.
- 2
- CLEAN, PREP AND RE-PAINT HISTORIC WOOD PORTICO.
- 3
- CLEAN, PREP AND RE-PAINT HISTORIC WOOD PORTICO, TRIM, RAILING AND BRACKETS.
- 4
- CLEAN, PREP AND RE-PAINT EXISTING WOOD GABLE TRIM, SOFFIT AND FASCIA.
- 5
- CLEAN, PREP AND RE-PAINT EXISTING HISTORIC WOOD DORMER, WINDOW FRAMES, WINDOW SASHES, DECORATIVE TRIMS, SOFFIT, FASCIA AND OUTRIGGERS.
- 6
- CLEAN, PREP AND RE-PAINT EXISTING HISTORIC WOOD DOOR AND TRANSOM.
- 7
- CLEAN, PREP AND RE-PAINT EXISTING HISTORIC SOFFIT, OUTRIGGERS AND BRACKETS.




1 EAST ELEVATION PHOTOS
N.T.S.

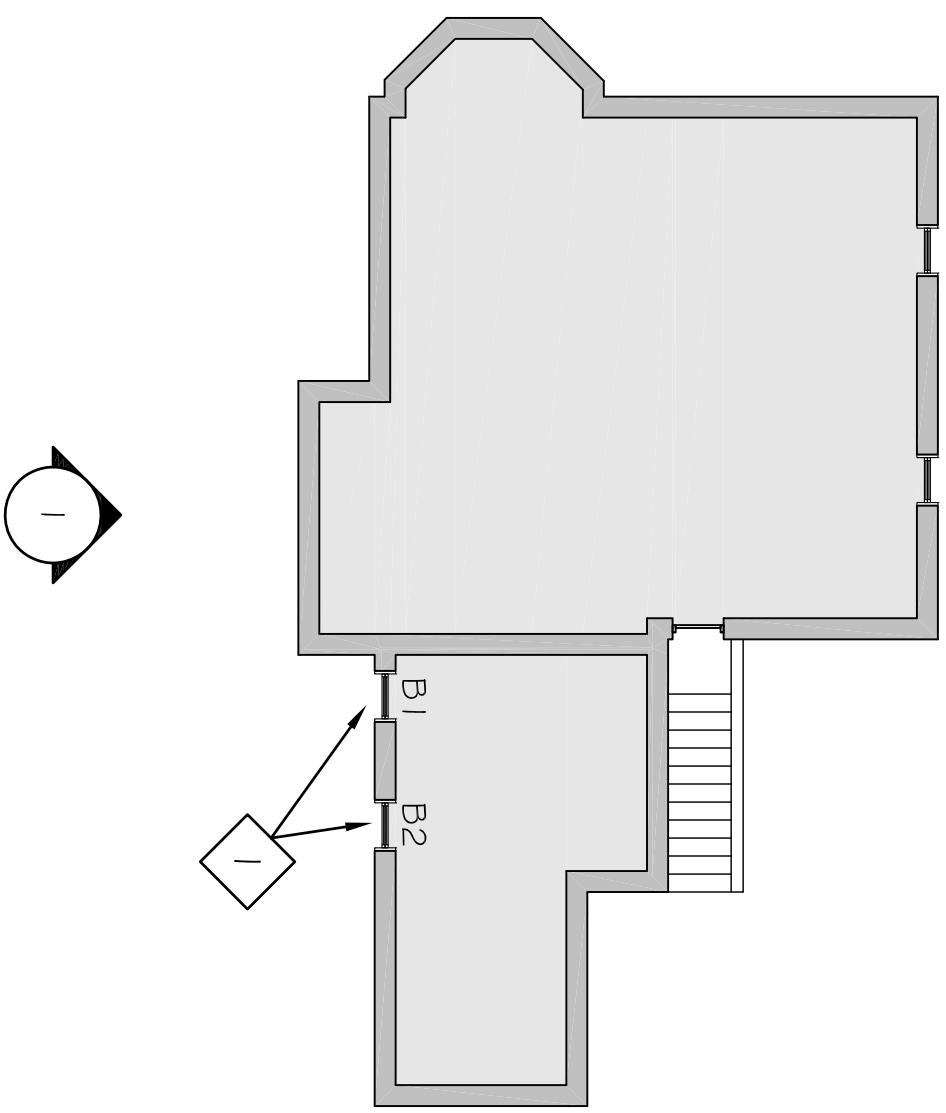


BASEMENT FLOOR PLAN
SCALE: 3/32" = 1'-0"

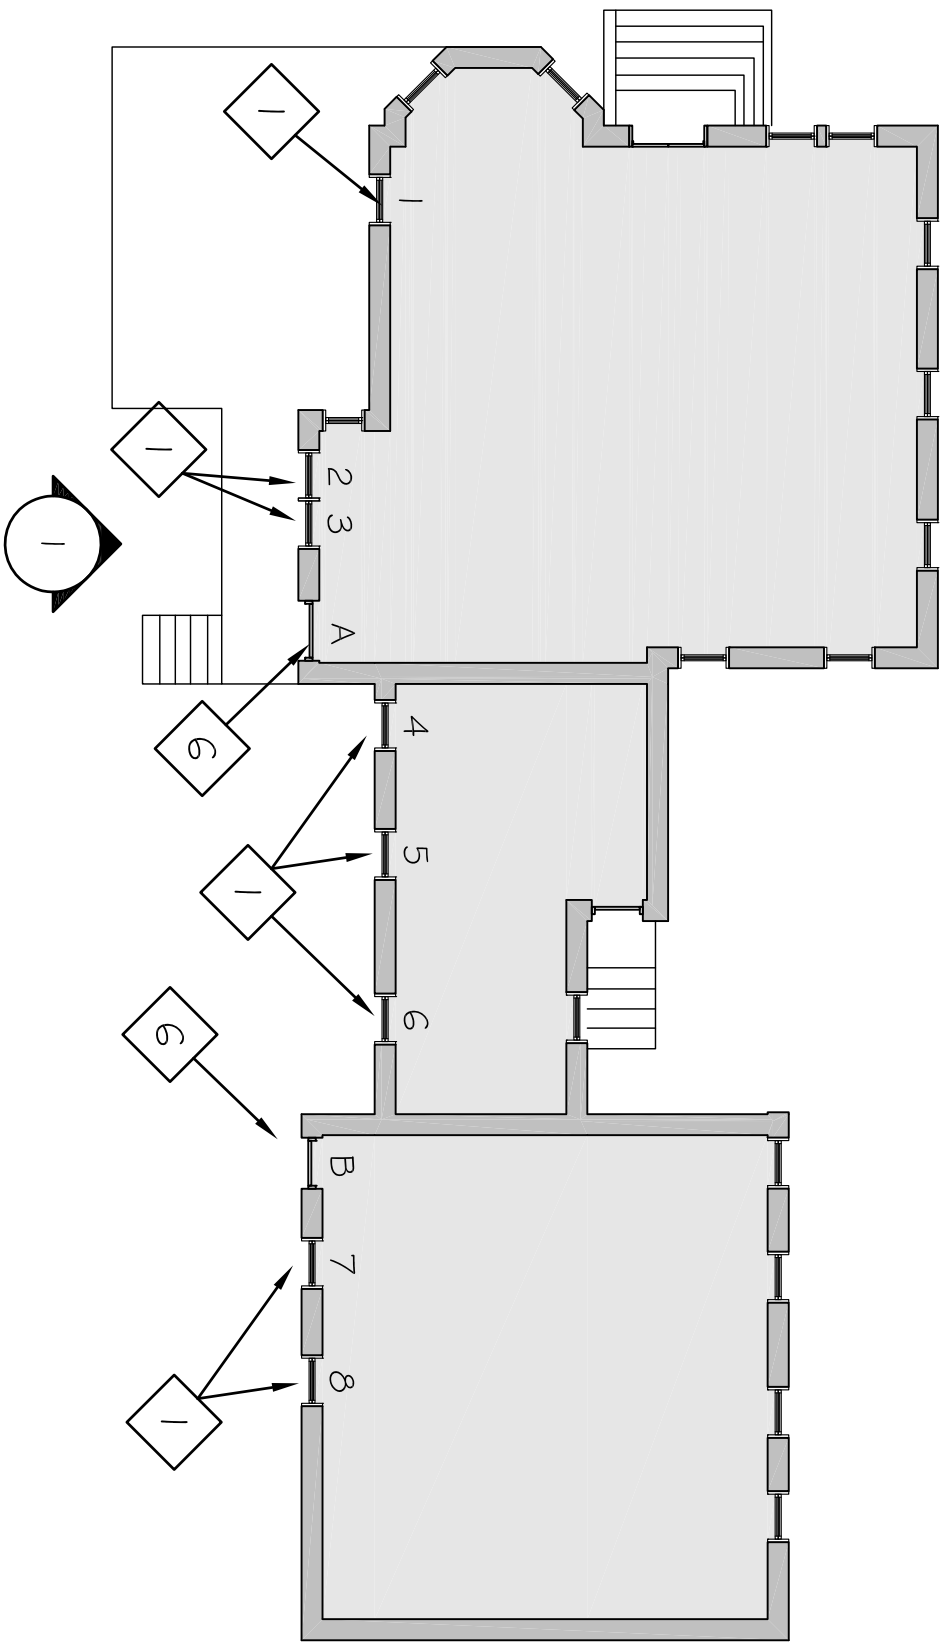

FIRST FLOOR PLAN
SCALE: 3/32" = 1'-0"

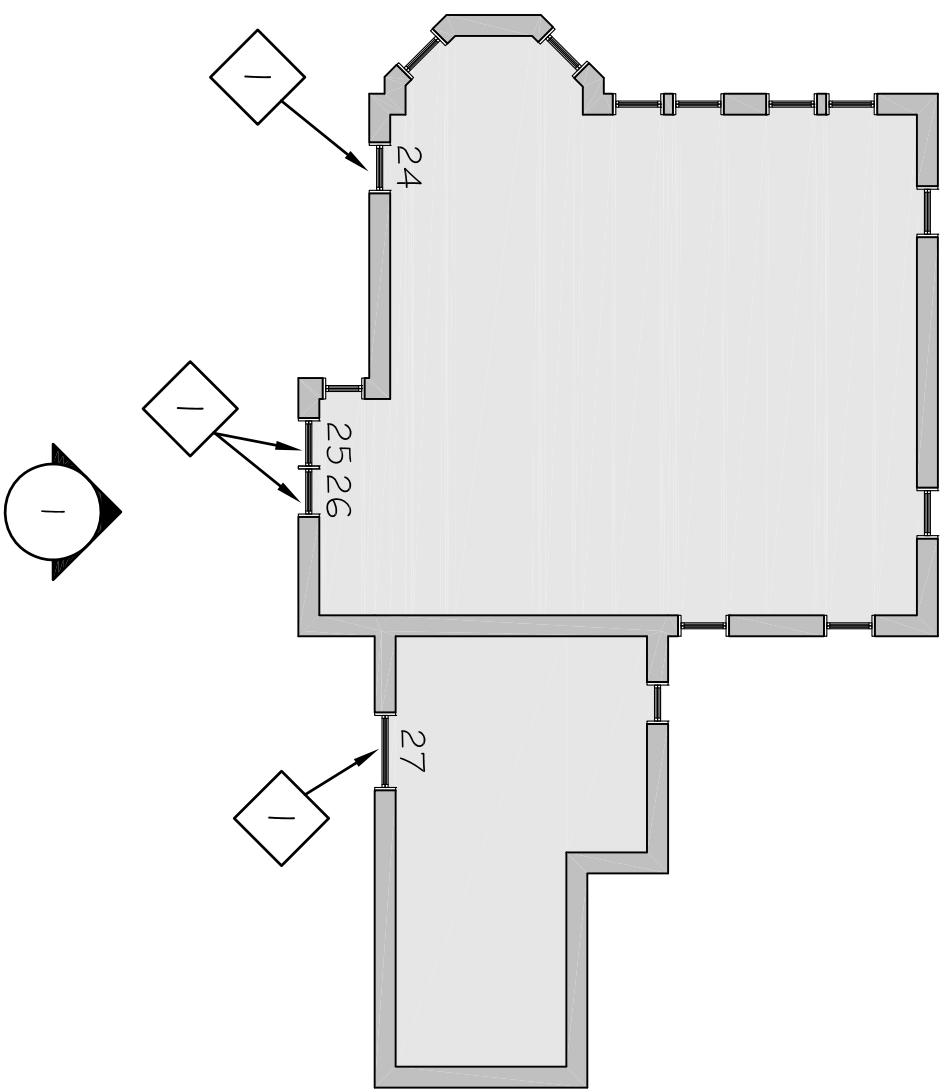

SECOND FLOOR PLAN
SCALE: 3/32" = 1'-0"

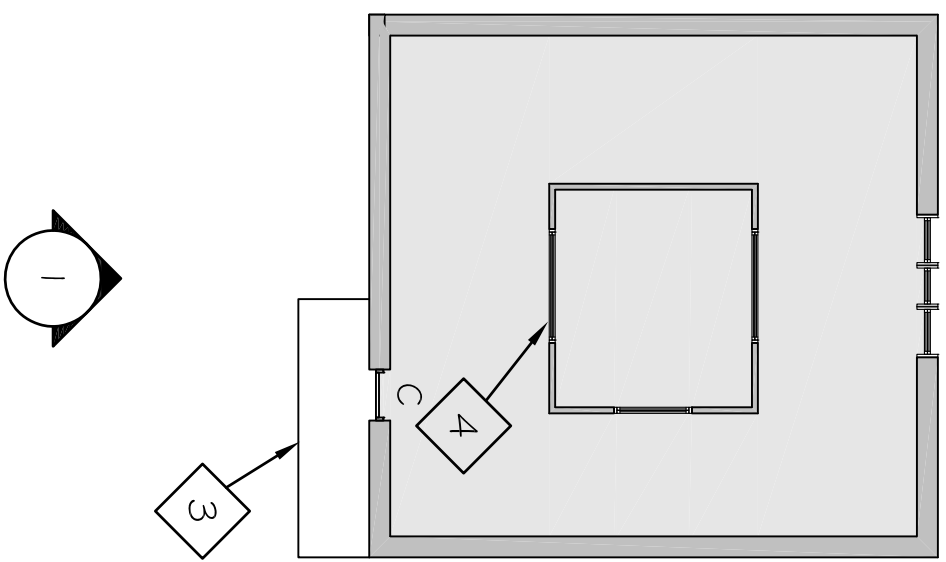

THIRD FLOOR PLAN
SCALE: 3/32" = 1'-0"




THIS IS AN ORIGINAL DESIGN, CREATED BY SRKM ARCHITECTURE, INC. IT IS SUBMITTED FOR USE IN THIS PROJECT AND IS UNDER THE DOMINION AND CONTROL OF THE ARCHITECT. ANY OTHER USE OR REPRODUCTION OF THIS INFORMATION WITHOUT THE WRITTEN CONSENT OF SRKM ARCHITECTURE, INC. OR SRKM PARTNERS, WINDY, INDIANA, IS PROHIBITED.

REVISION:

EAST WINDOW REHABILITATION
WESTCHESTER TOWNSHIP MUSEUM
700 W PORTER, CHESTERTON, IN



2 SOUTH ELEVATION PHOTO
N.T.S.

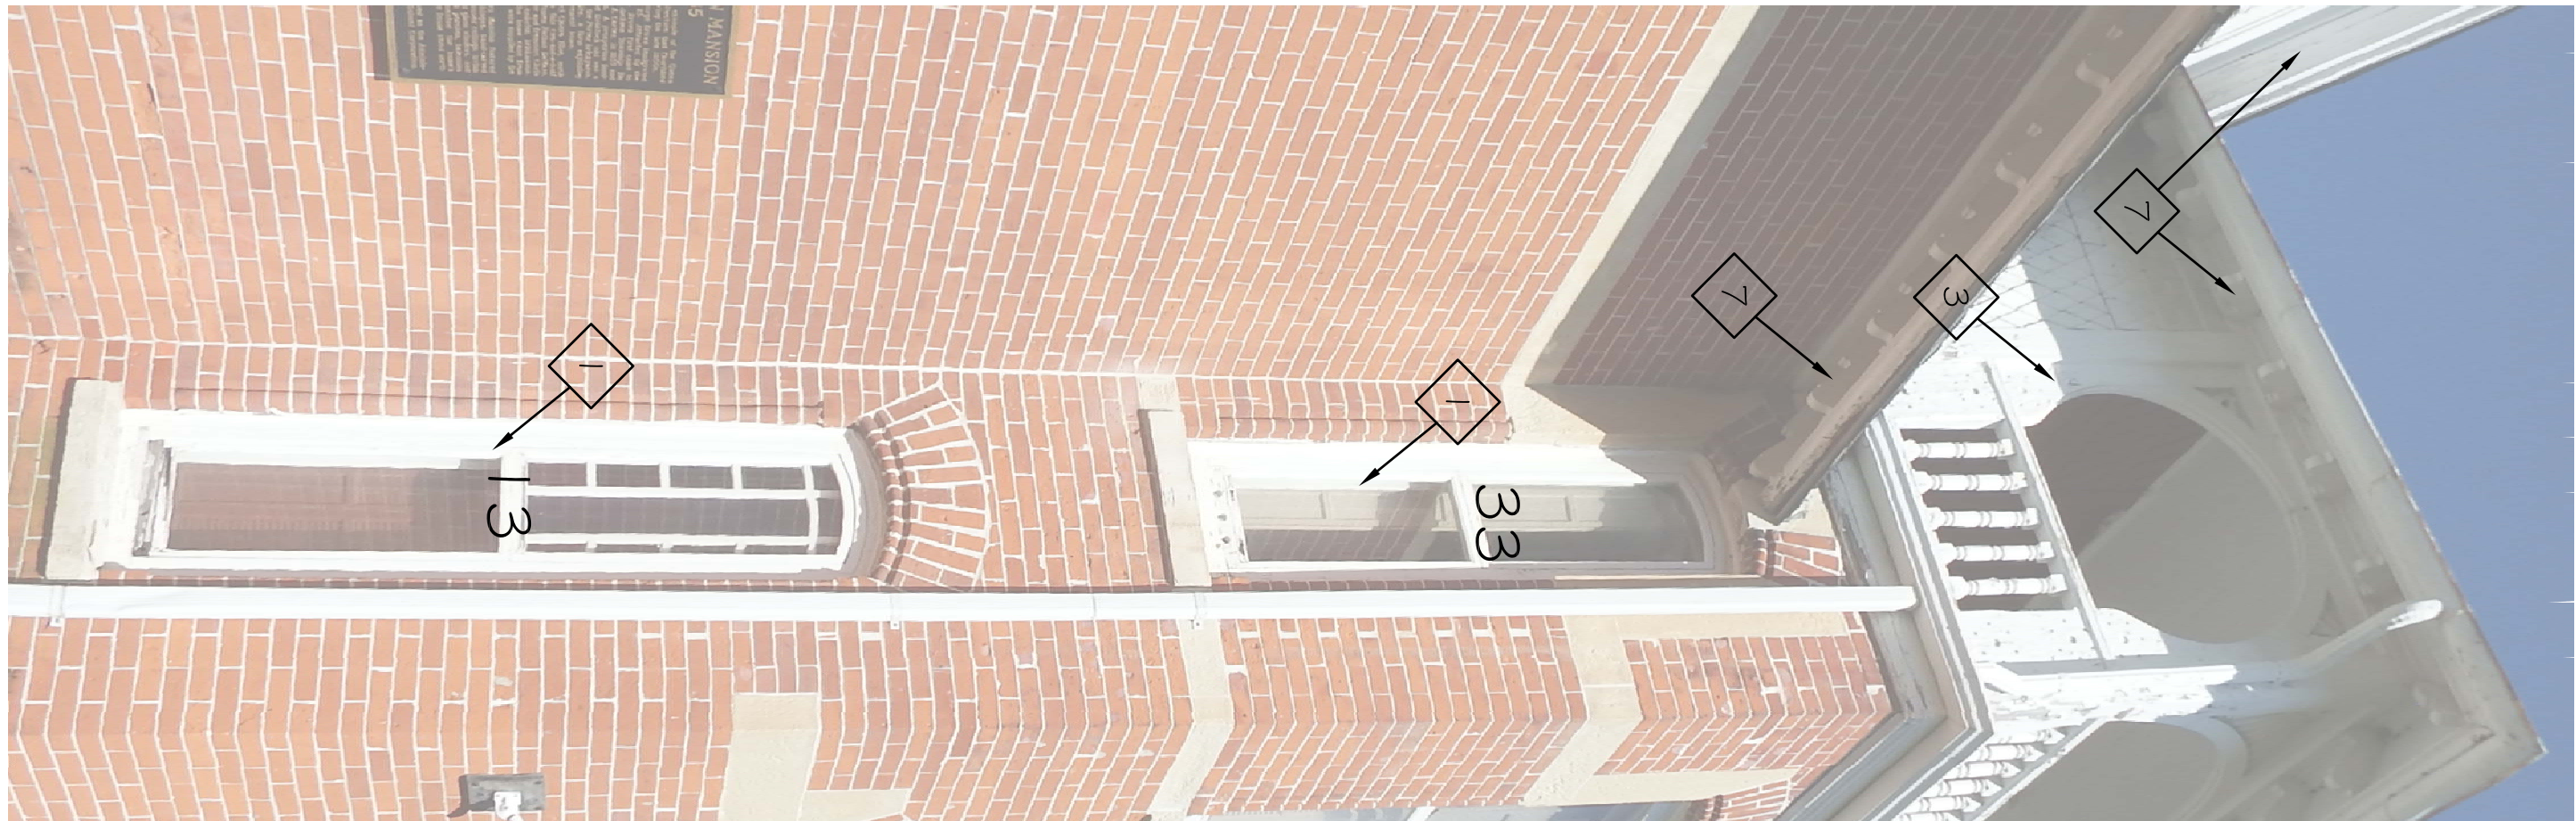

3 SOUTH ELEVATION PHOTO
N.T.S.

PROJECT NOTE:
WOOD COMPONENTS HAVE DETERIORATED BEYOND REPAIR IN A NUMBER OF LOCATIONS AND SHALL BE REPLACED WITH NEW COMPONENTS OF POPLAR OF DIMENSIONS TO MATCH EXISTING EXACTLY. NOMINAL SIZE LUMBER SHALL NOT BE ACCEPTABLE.

FLOOR PLAN KENNOTES:

- 1 EXISTING WINDOW CONSISTS OF HISTORIC FRAMES AND SASHES WITH WOOD STORM WINDOW. REMOVE WOOD STORM WINDOW, CLEAN, PREP, AND REPAINT OFF SITE AND REINSTALL. CLEAN, PREP AND REPAINT HISTORIC FRAMES, WINDOW SASHES, SILLS, TRIM, AND STOOLS. SEE DIVISION EIGHT SPECIFICATIONS FOR SPECIFIC DETAIL.
- 2 CLEAN, PREP AND RE-PAINT HISTORIC WOOD PORTICO.
- 3 CLEAN, PREP AND RE-PAINT HISTORIC WOOD PORTICO, TRIM, RAILING AND BRACKETS.
- 4 CLEAN, PREP AND RE-PAINT EXISTING WOOD GABLE TRIM, SOFFIT AND FASCIA.
- 5 CLEAN, PREP AND RE-PAINT EXISTING HISTORIC WOOD DORMER, WINDOW FRAMES, WINDOW SASHES, DECORATIVE TRIMS, SOFFIT, FASCIA AND OUTRIGGERS.
- 6 CLEAN, PREP AND RE-PAINT EXISTING HISTORIC WOOD DOOR AND TRANSOM.
- 7 CLEAN, PREP AND RE-PAINT EXISTING HISTORIC SOFFIT, OUTRIGGERS AND BRACKETS.



THIS IS AN ORIGINAL DESIGN, CREATED BY SRKM ARCHITECTURE, INC. IT IS SUBMITTED FOR USE IN THIS PROJECT AND IS UNDER THE DOMINION AND CONTROL OF THE ARCHITECT. ANY OTHER USE OR REPRODUCTION OF THIS INFORMATION WITHOUT THE WRITTEN CONSENT OF SRKM ARCHITECTURE, INC. OR SRKM PARTNERS, INDIANAPOLIS, INDIANA, IS PROHIBITED.


REVISION:

SOUTH WINDOW REHABILITATION
WESTCHESTER TOWNSHIP MUSEUM
700 W PORTER, CHESTERTON, IN


SRKM

architecture


120 SOUTH BURLING WASHINGTON, IN 46260
PHONE 574.428.1586
WWW.SRKMARCH.COM

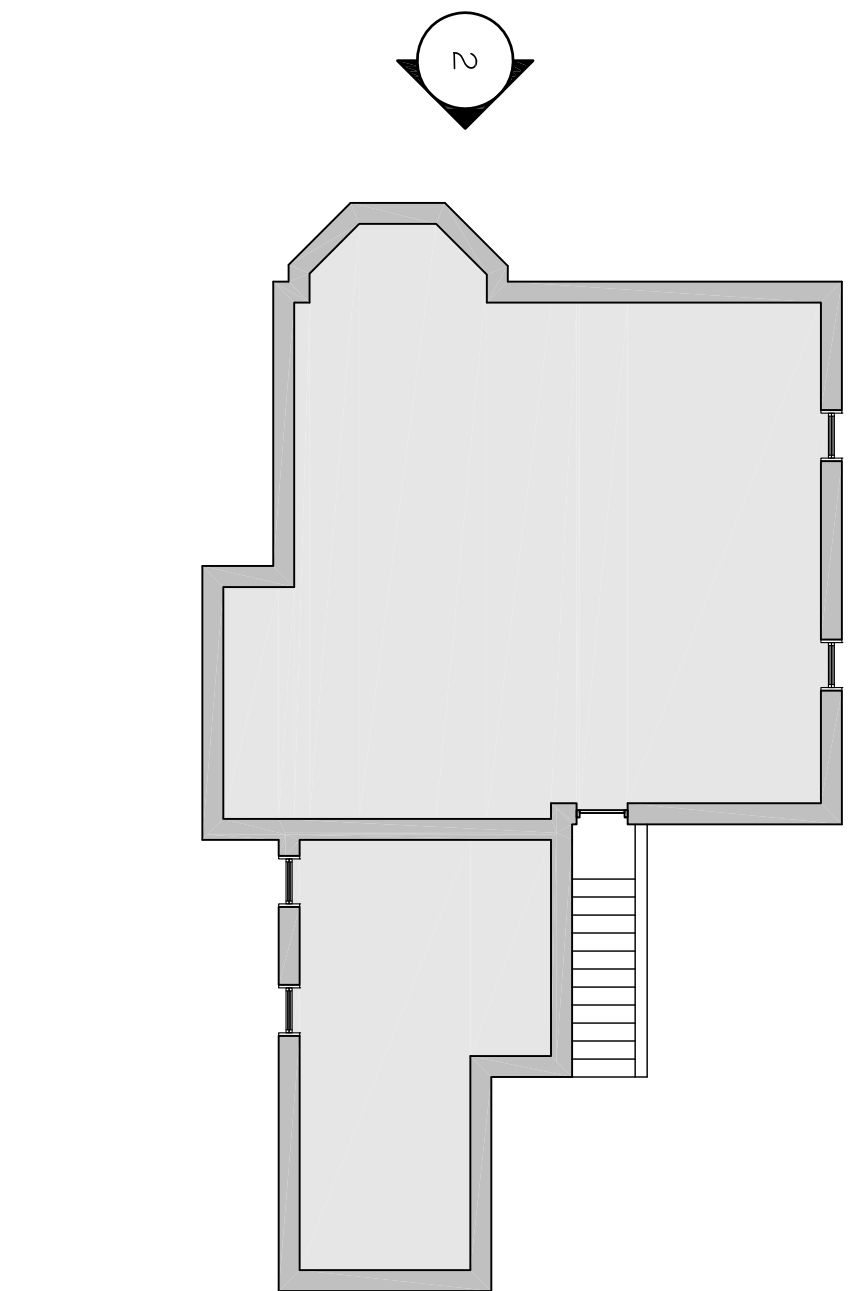


BASEMENT FLOOR PLAN
SCALE: 3/32" = 1'-0"

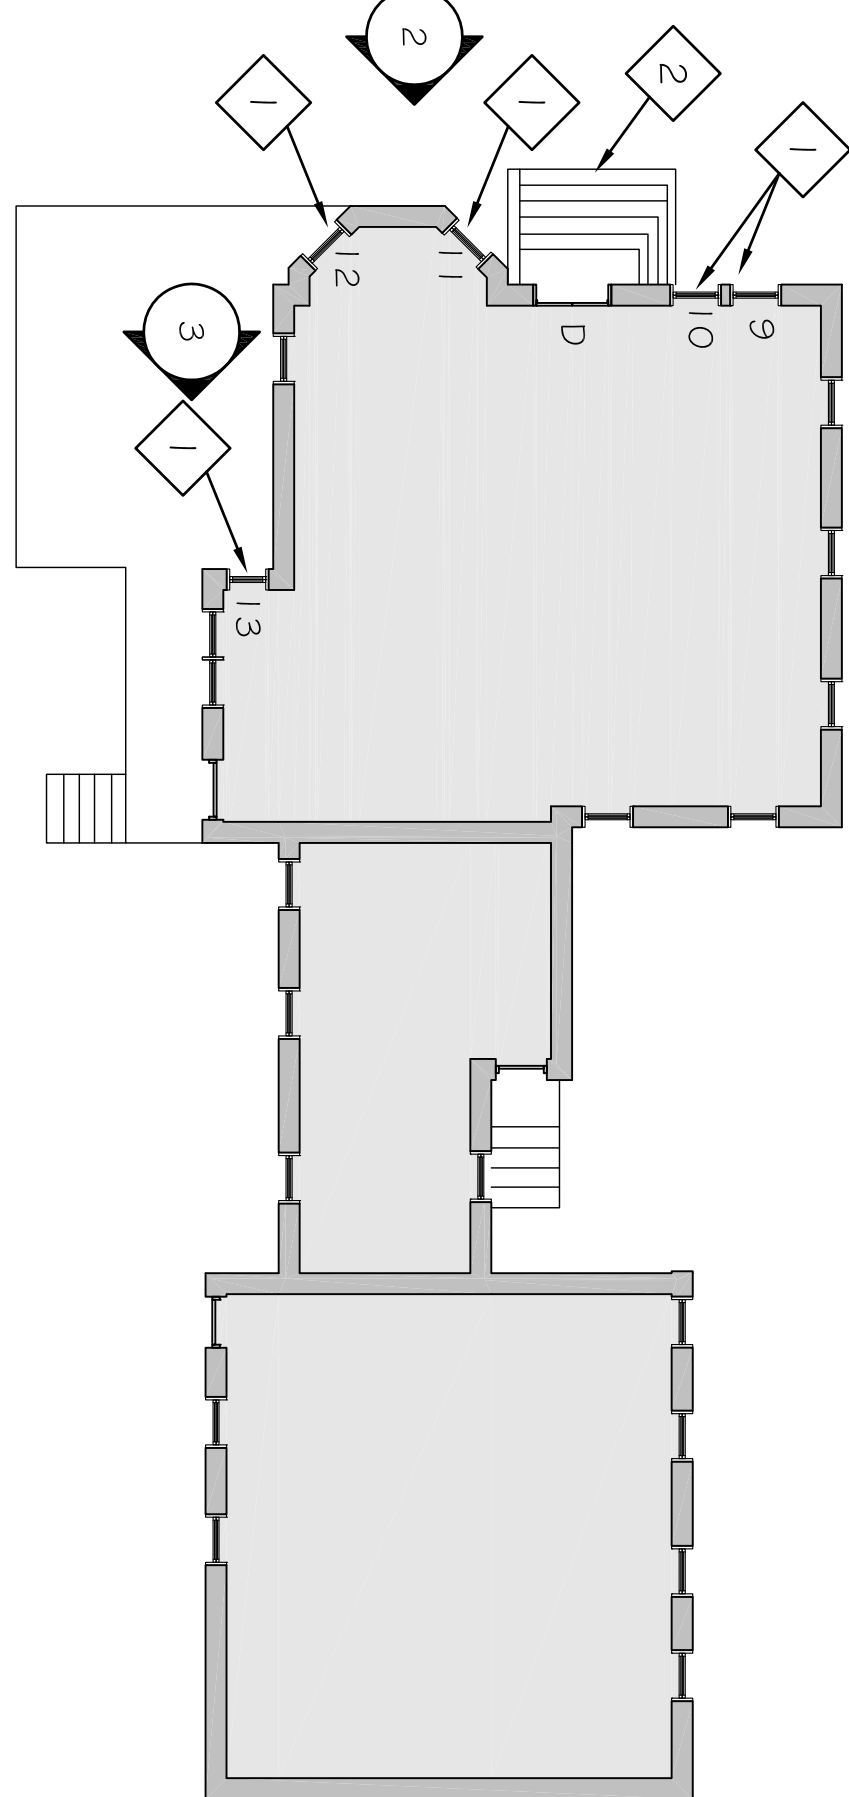

FIRST FLOOR PLAN
SCALE: 3/32" = 1'-0"

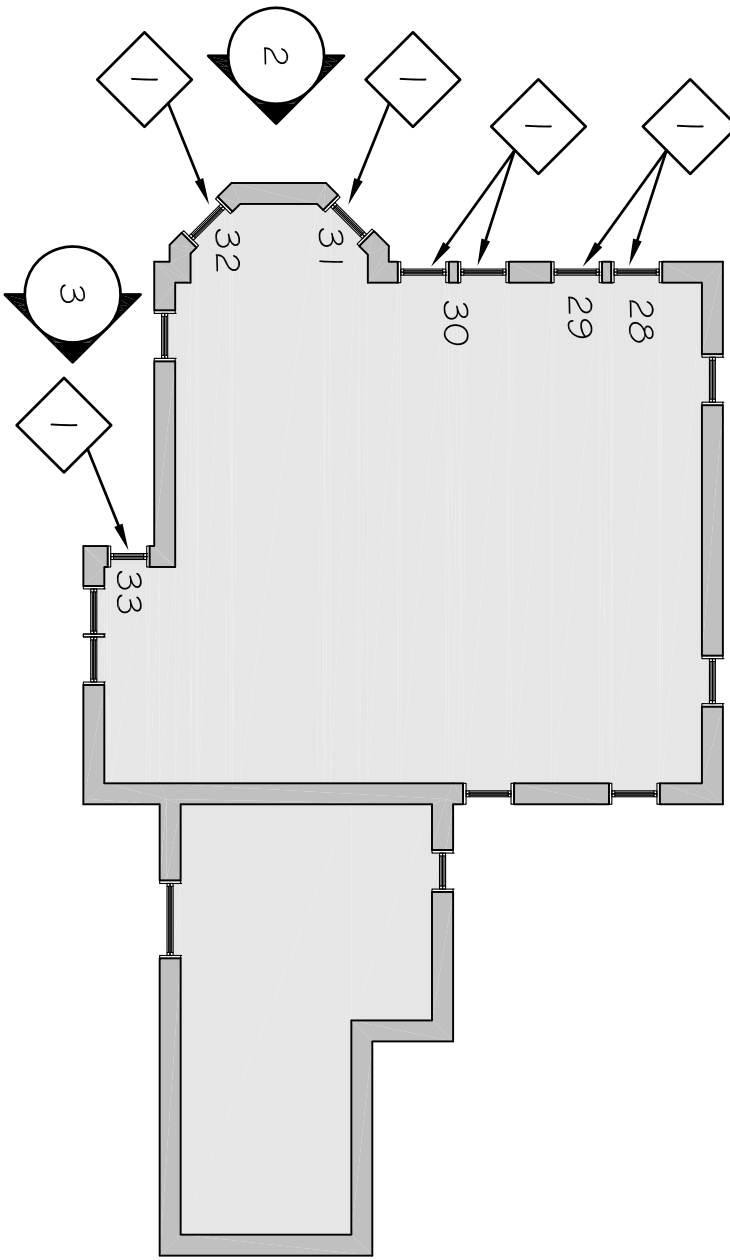

SECOND FLOOR PLAN
SCALE: 3/32" = 1'-0"

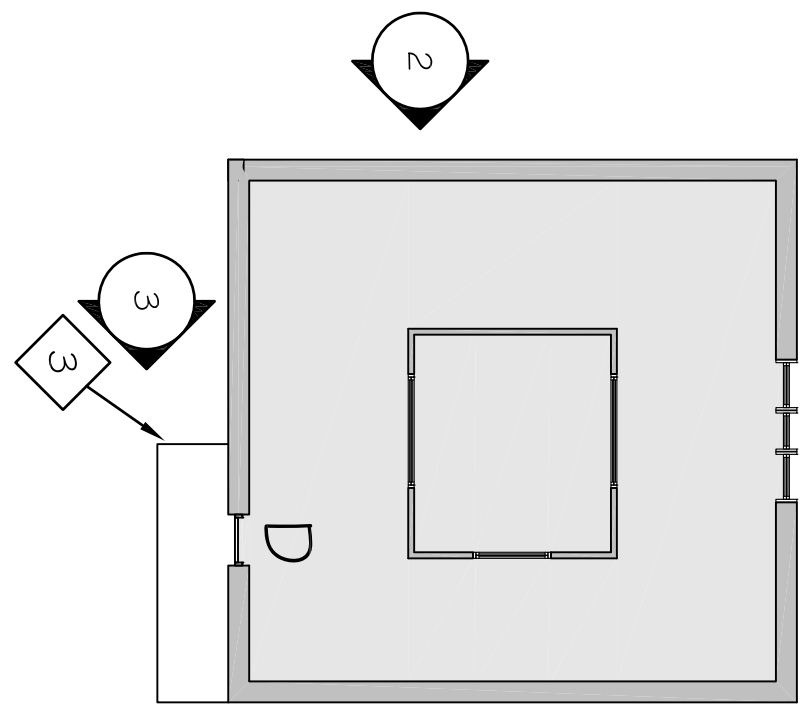


THIRD FLOOR PLAN
SCALE: 3/32" = 1'-0"




PROJECT No. 2015-031
DRAWN BY: JIK/BAM
CHECKED BY: DDB
DATE: SEPTEMBER 2015


SHEET No. A2.2

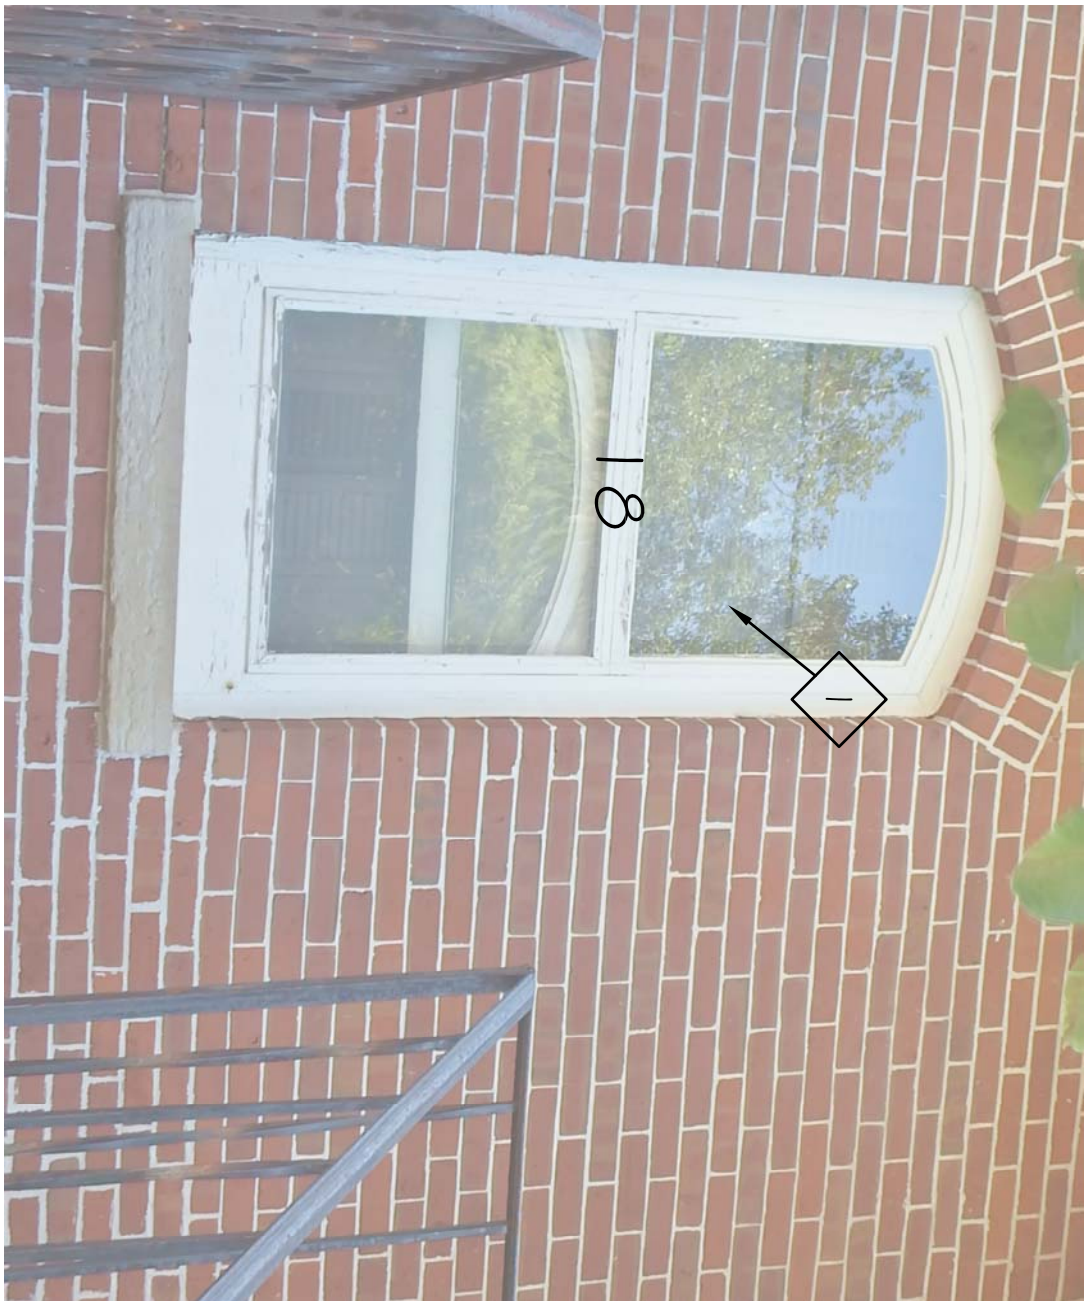


4 WEST ELEVATION PHOTO
N.T.S.

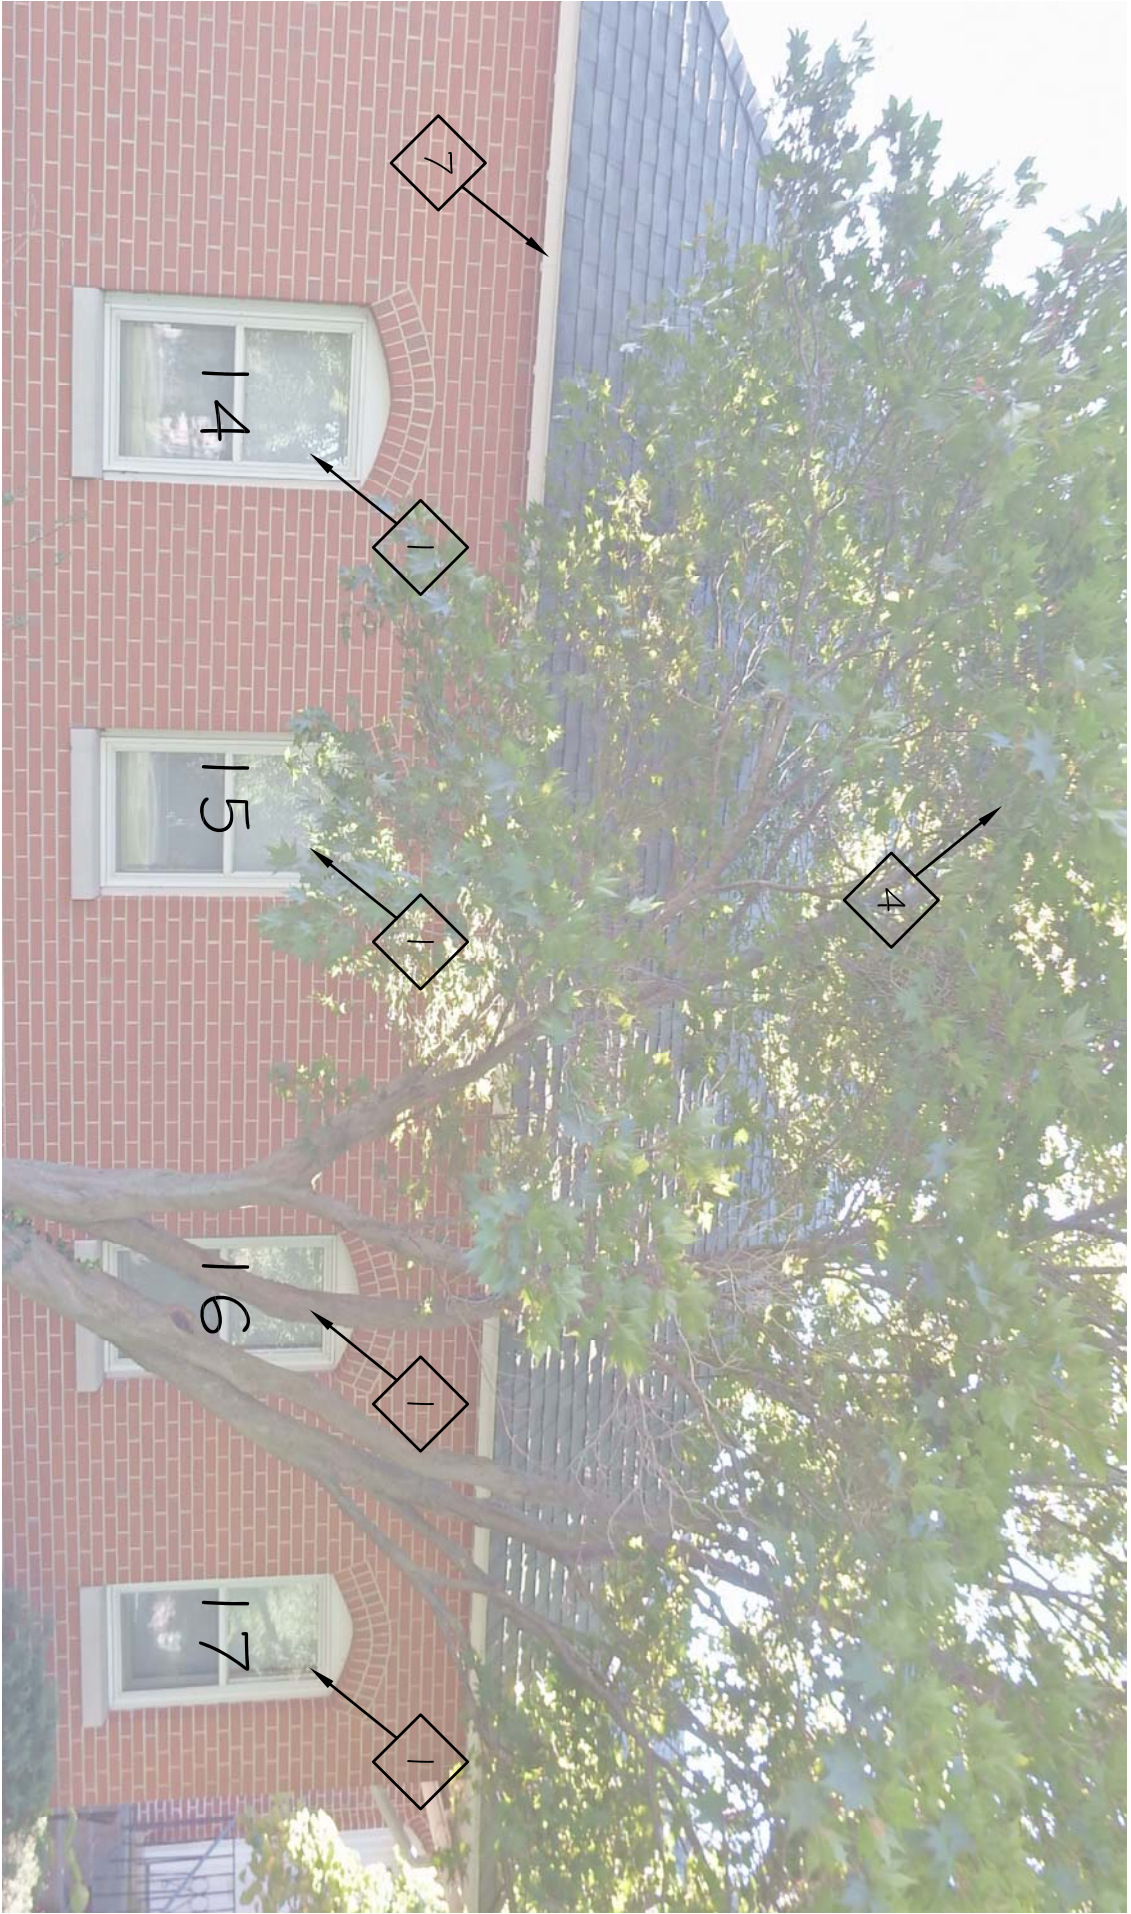

5 WEST ELEVATION PHOTO
N.T.S.

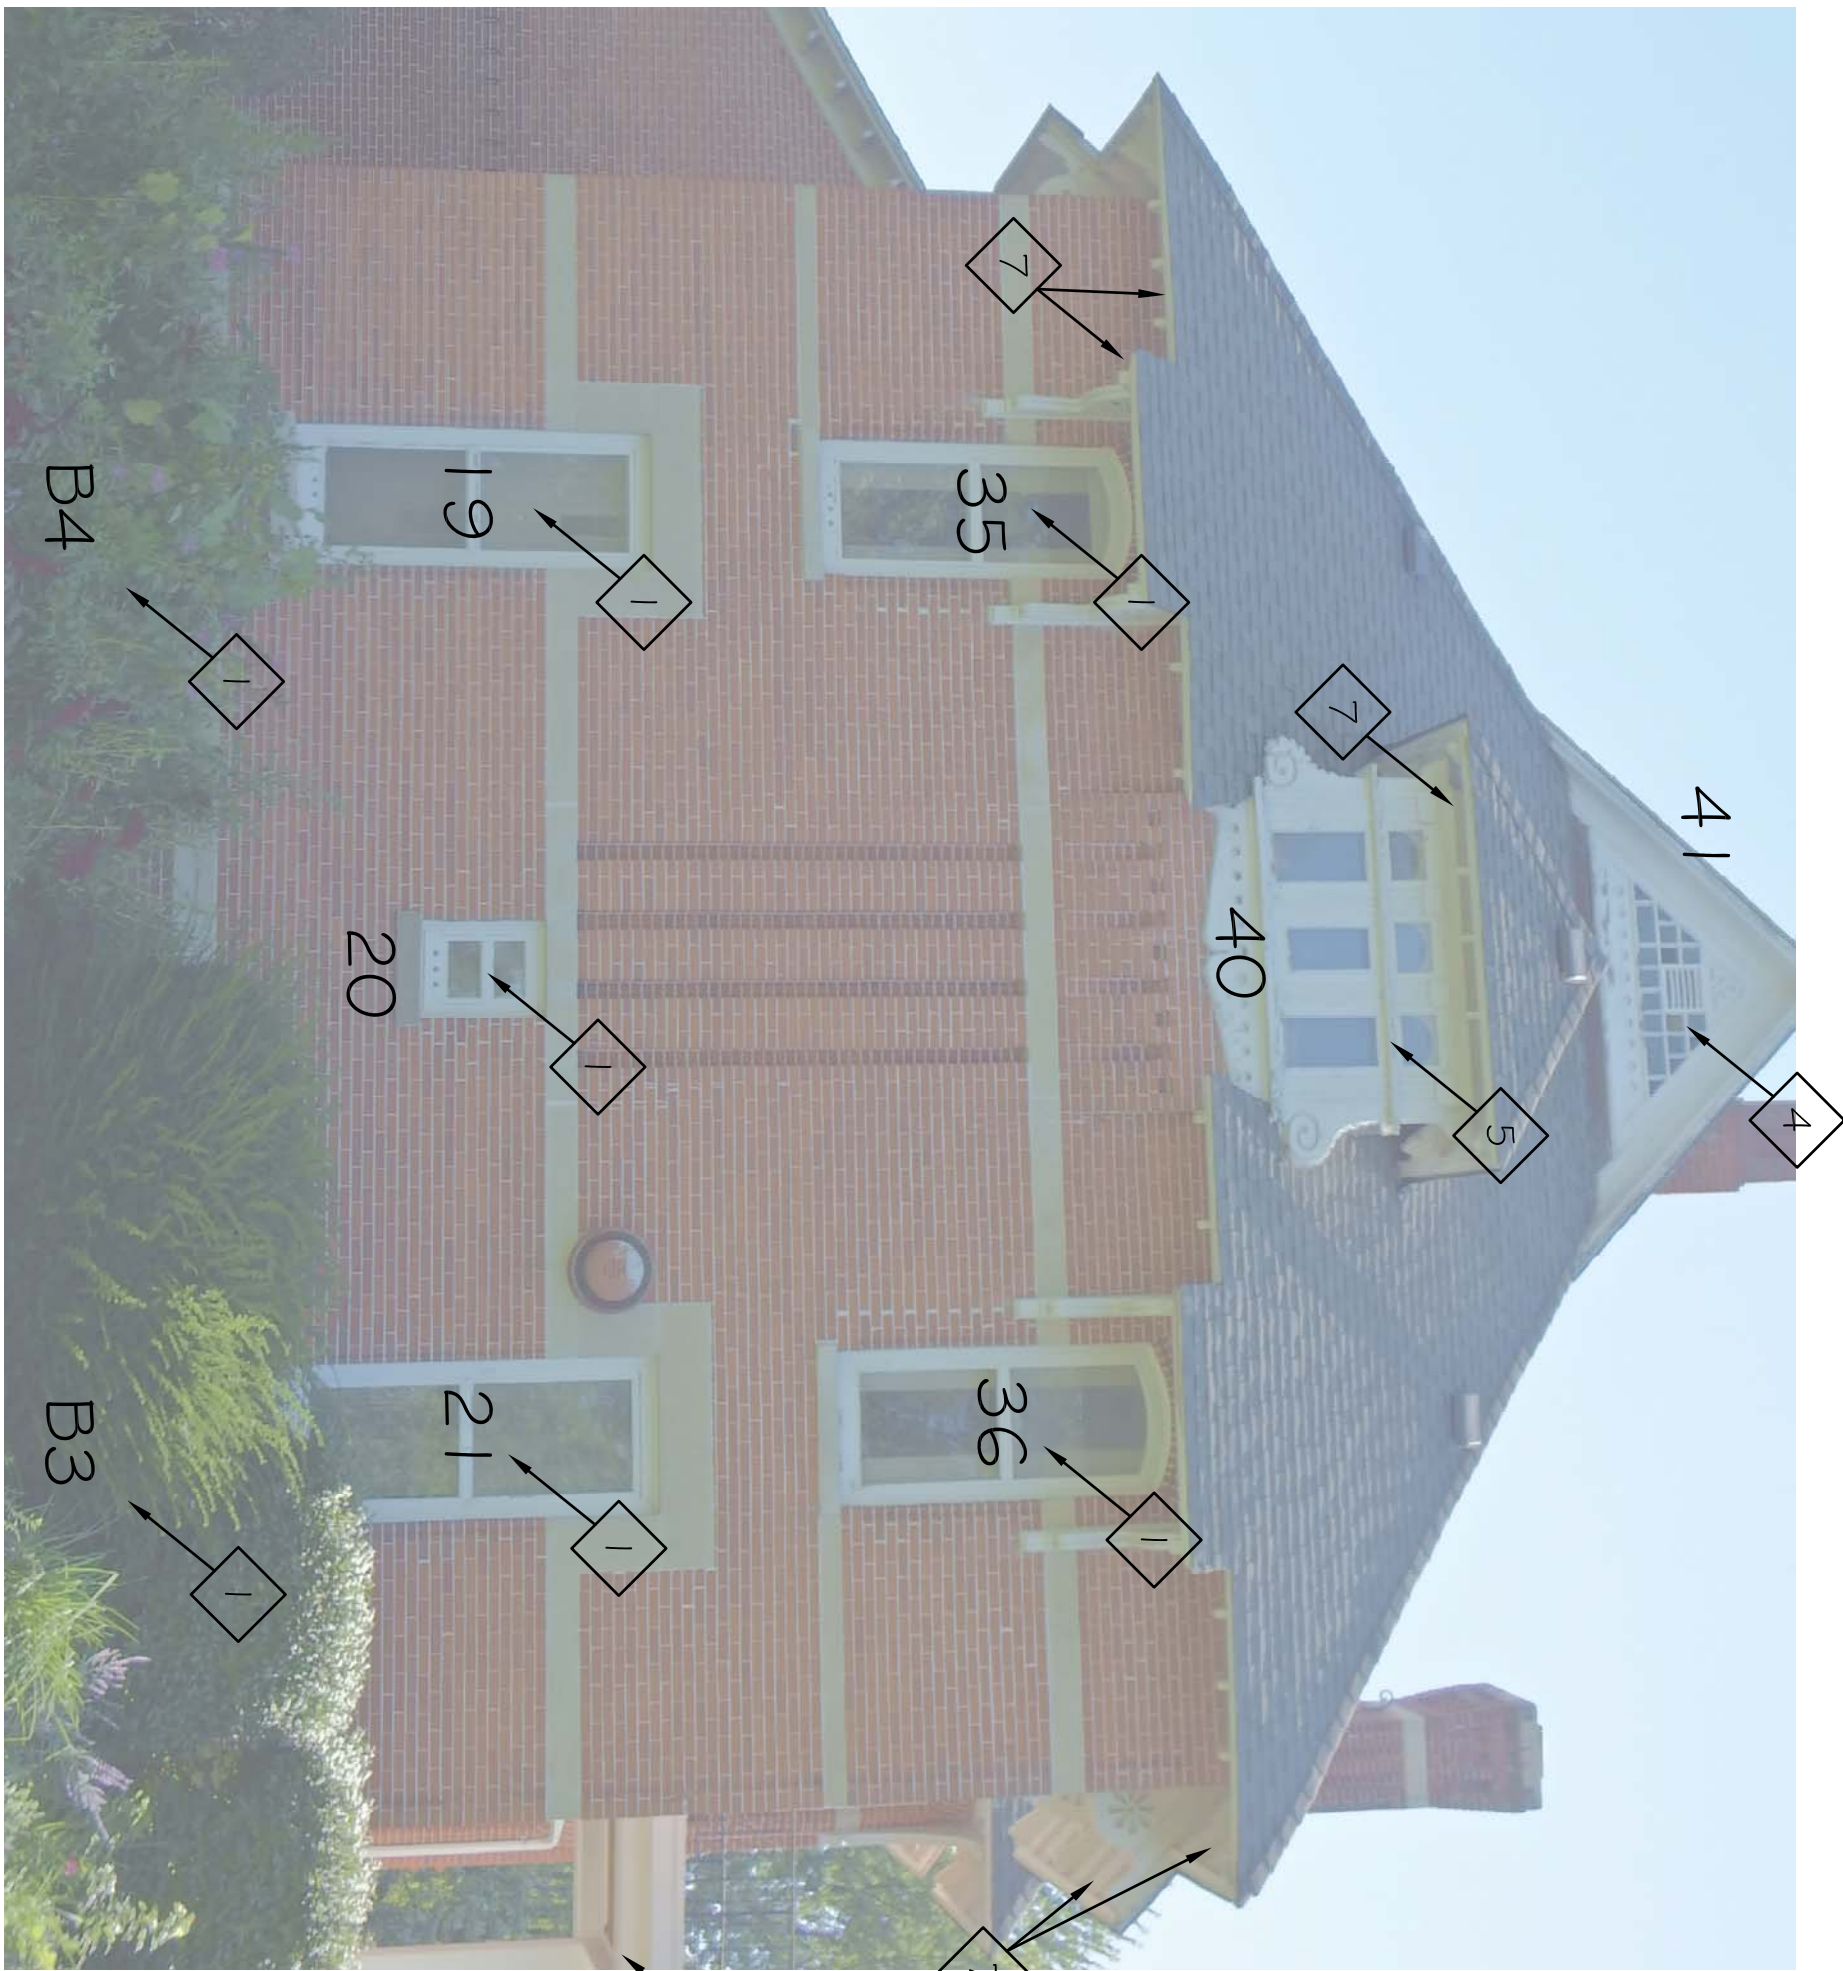

6 WEST ELEVATION PHOTO
N.T.S.

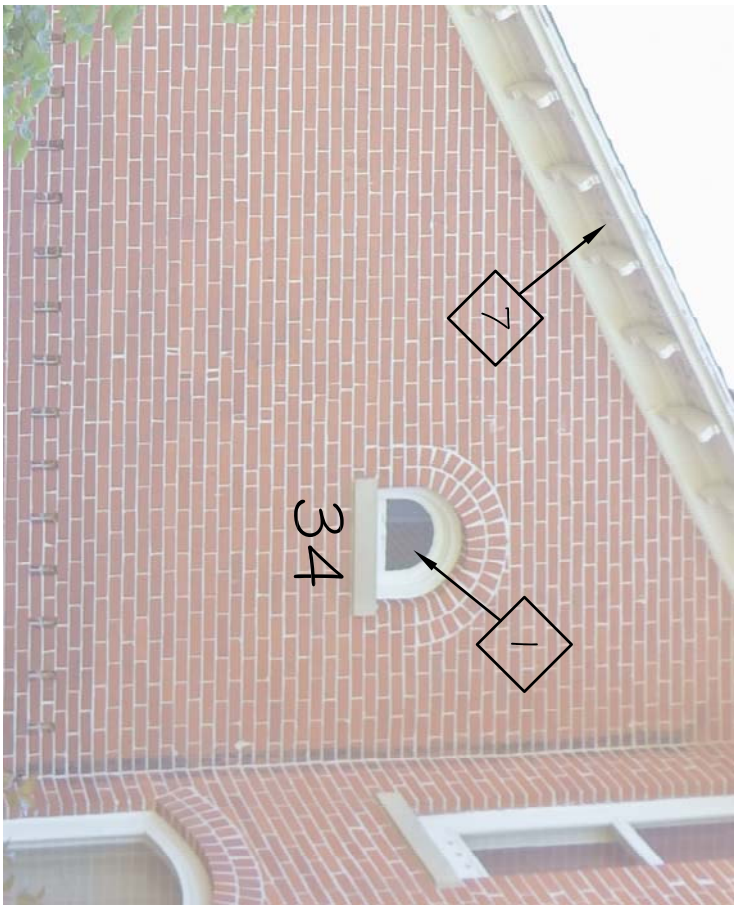


7 WEST ELEVATION PHOTO
N.T.S.


PROJECT NOTE:
WOOD COMPONENTS HAVE DETERIORATED BEYOND REPAIR IN A NUMBER OF LOCATIONS AND SHALL BE REPLACED WITH NEW COMPONENTS OF POPLAR OF DIMENSIONS TO MATCH EXISTING EXACTLY. NOMINAL SIZE LUMBER SHALL NOT BE ACCEPTABLE.

FLOOR PLAN KENNOTES:


- 1 EXISTING WINDOW CONSISTS OF HISTORIC FRAMES AND SASHES WITH WOOD STORM WINDOW. REMOVE WOOD STORM WINDOW, CLEAN, PREP, AND REPAINT OFF SITE AND REINSTALL. CLEAN, PREP AND REPAINT HISTORIC FRAMES, WINDOW SASHES, SILLS, TRIM, AND STOOLS. SEE DIVISION EIGHT SPECIFICATIONS FOR SPECIFIC DETAIL.
- 2 CLEAN, PREP AND RE-PAINT HISTORIC WOOD PORTICO.
- 3 CLEAN, PREP AND RE-PAINT HISTORIC WOOD PORTICO, TRIM, RAILING AND BRACKETS.
- 4 CLEAN, PREP AND RE-PAINT EXISTING WOOD GABLE TRIM, SOFFIT AND FASCIA.
- 5 CLEAN, PREP AND RE-PAINT EXISTING HISTORIC WOOD DORMER, WINDOW FRAMES, WINDOW SASHES, DECORATIVE TRIMS, SOFFIT, FASCIA AND OUTRIGGERS.
- 6 CLEAN, PREP AND RE-PAINT EXISTING HISTORIC WOOD DOOR AND TRANSOM.
- 7 CLEAN, PREP AND RE-PAINT EXISTING HISTORIC SOFFIT, OUTRIGGERS AND BRACKETS.

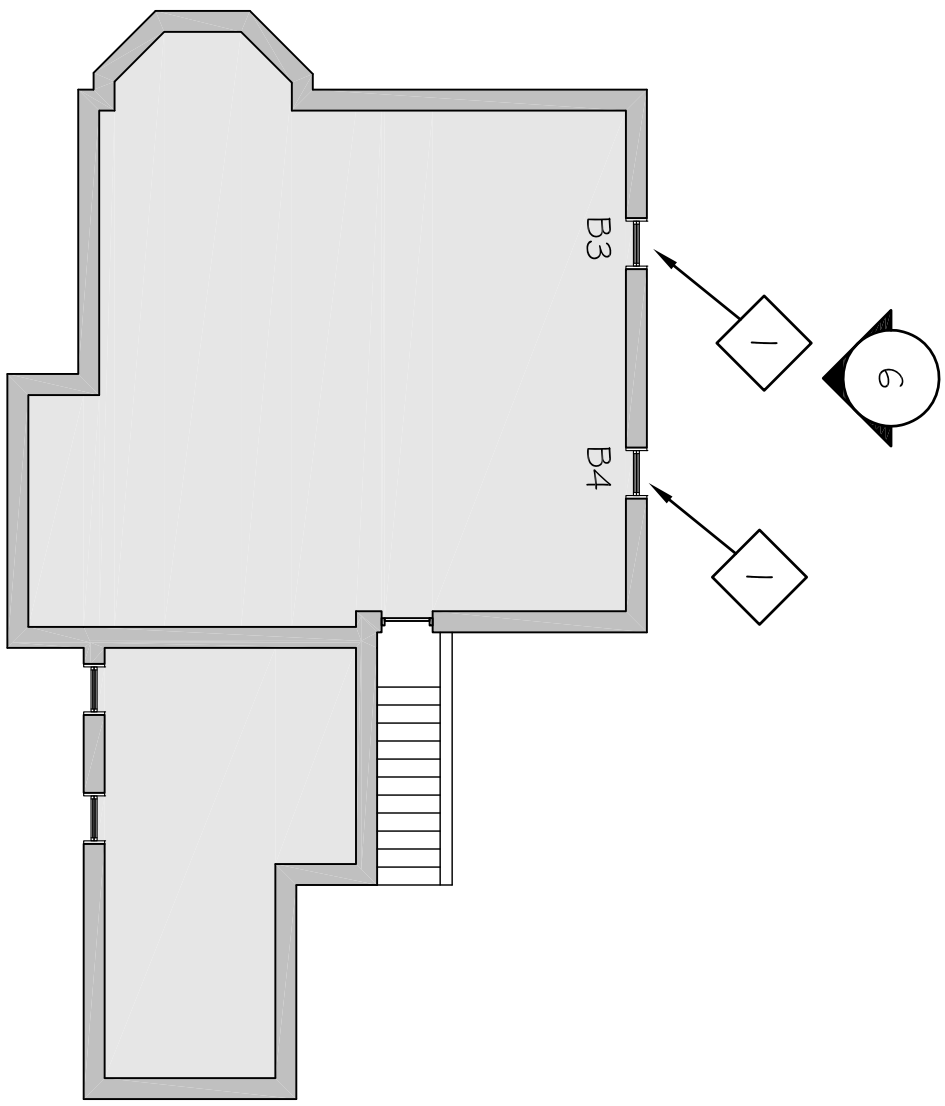


BASEMENT FLOOR PLAN
SCALE: 3/32" = 1'-0"

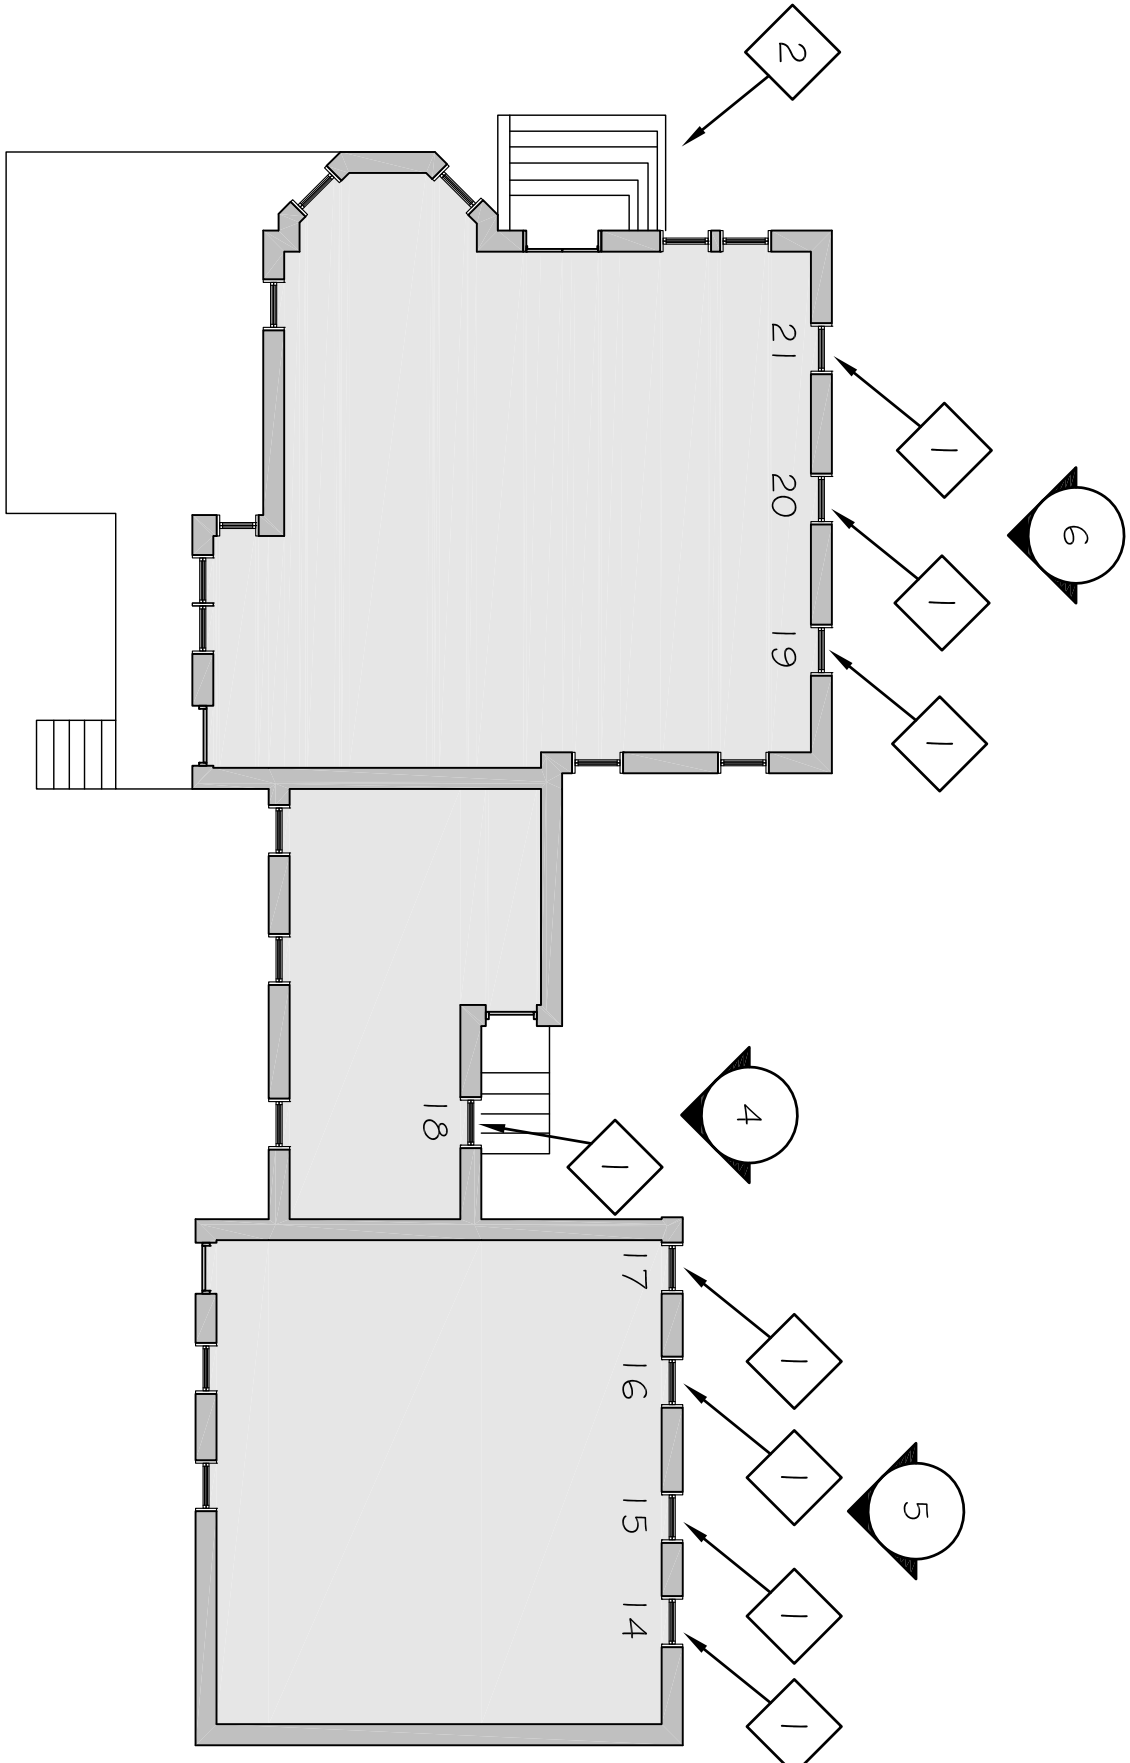

FIRST FLOOR PLAN
SCALE: 3/32" = 1'-0"

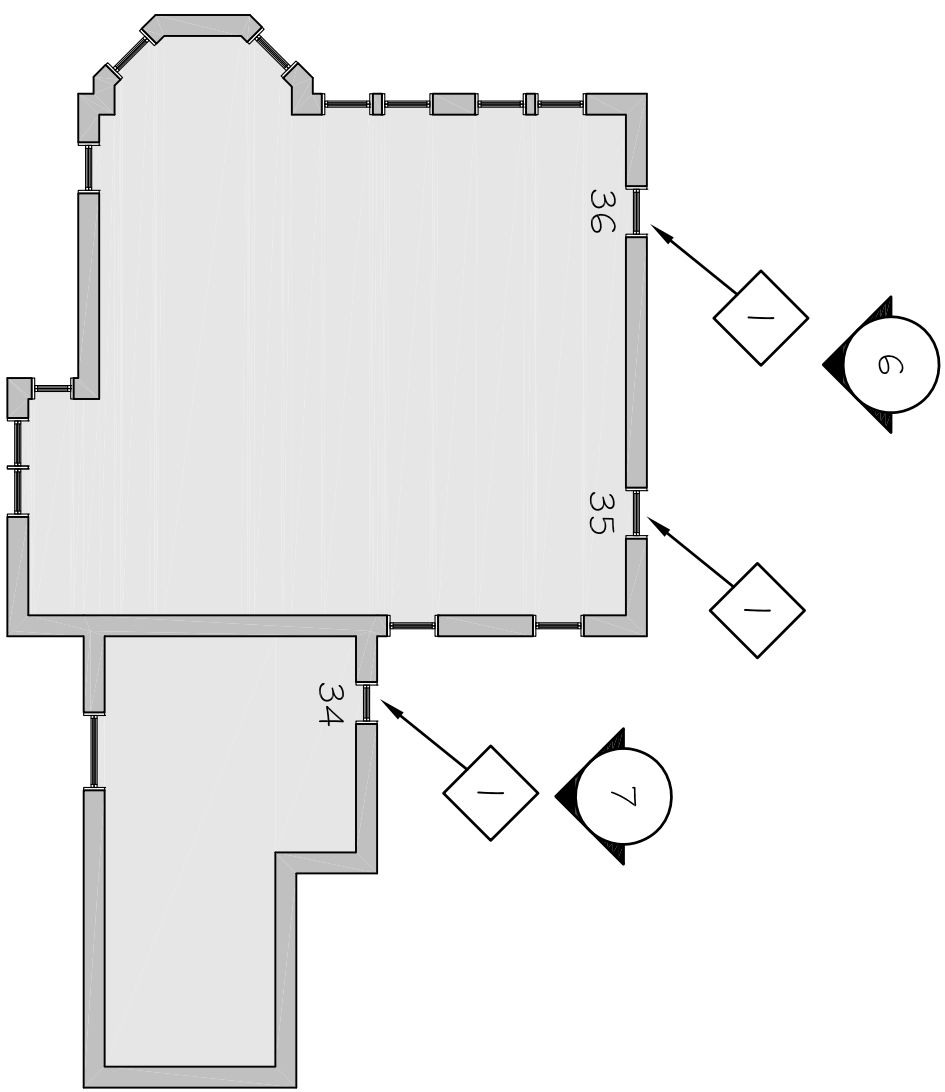

SECOND FLOOR PLAN
SCALE: 3/32" = 1'-0"

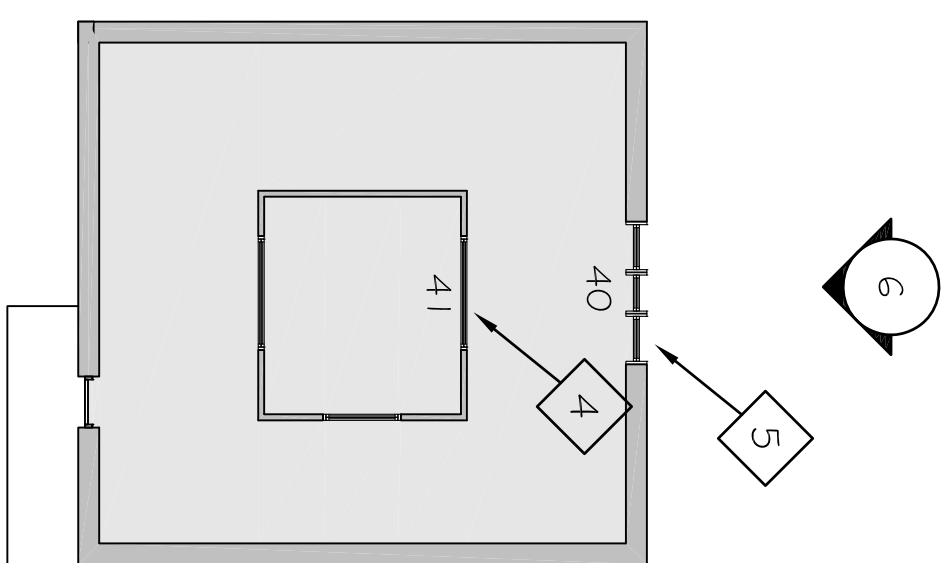

THIRD FLOOR PLAN
SCALE: 3/32" = 1'-0"



THIS IS AN ORIGINAL DESIGN, CREATED BY SRKM ARCHITECTURE, INC. IT IS SUBMITTED FOR USE IN THIS PROJECT AND IS UNDER THE DOMINION AND CONTROL OF THE ARCHITECT. ANY OTHER USE, OR REPRODUCTION OF THIS INFORMATION WITHOUT THE WRITTEN CONSENT OF SRKM ARCHITECTURE, INC. OR SRKM ARCHITECTURE, INC. OF 325 SOUTH RUFFALO, INDIANA, IS PROHIBITED.

REVISION:

WEST WINDOW REHABILITATION
WESTCHESTER TOWNSHIP MUSEUM
700 W PORTER, CHESTERTON, IN


PROJECT No.	2015-031
DRAWN BY:	DDB
CHECKED BY:	JLK/BAM
DATE:	SEPTEMBER 2015
SHEET No.	A2.3

PROJECT NOTE:

WOOD COMPONENTS HAVE DETERIORATED BEYOND REPAIR IN A NUMBER OF LOCATIONS AND SHALL BE REPLACED WITH NEW COMPONENTS OF POPLAR OF DIMENSIONS TO MATCH EXISTING EXACTLY. NOMINAL SIZE LUMBER SHALL NOT BE ACCEPTABLE.

FLOOR PLAN KEYNOTES:

- 1 EXISTING WINDOW CONSISTS OF HISTORIC FRAMES AND SASHES WITH WOOD STORM WINDOW. REMOVE WOOD STORM WINDOW, CLEAN, PREP, AND REPAINT OFF SITE AND REINSTALL. CLEAN, PREP AND REPAINT HISTORIC FRAMES, WINDOW SASHES, SILLS, TRIM, AND STOOLS. SEE DIVISION EIGHT SPECIFICATIONS FOR SPECIFIC DETAIL.
- 2 CLEAN, PREP AND RE-PAINT HISTORIC WOOD PORTICO.
- 3 CLEAN, PREP AND RE-PAINT HISTORIC WOOD PORTICO, TRIM, RAILING AND BRACKETS.
- 4 CLEAN, PREP AND RE-PAINT EXISTING WOOD GABLE TRIM, SOFFIT AND FASCIA.
- 5 CLEAN, PREP AND RE-PAINT EXISTING HISTORIC WOOD DORMER, WINDOW FRAMES, WINDOW SASHES, DECORATIVE TRIMS, SOFFIT, FASCIA AND OUTRIGGERS.
- 6 CLEAN, PREP AND RE-PAINT EXISTING HISTORIC WOOD DOOR AND TRANSOM.
- 7 CLEAN, PREP AND RE-PAINT EXISTING HISTORIC SOFFIT, OUTRIGGERS AND BRACKETS.

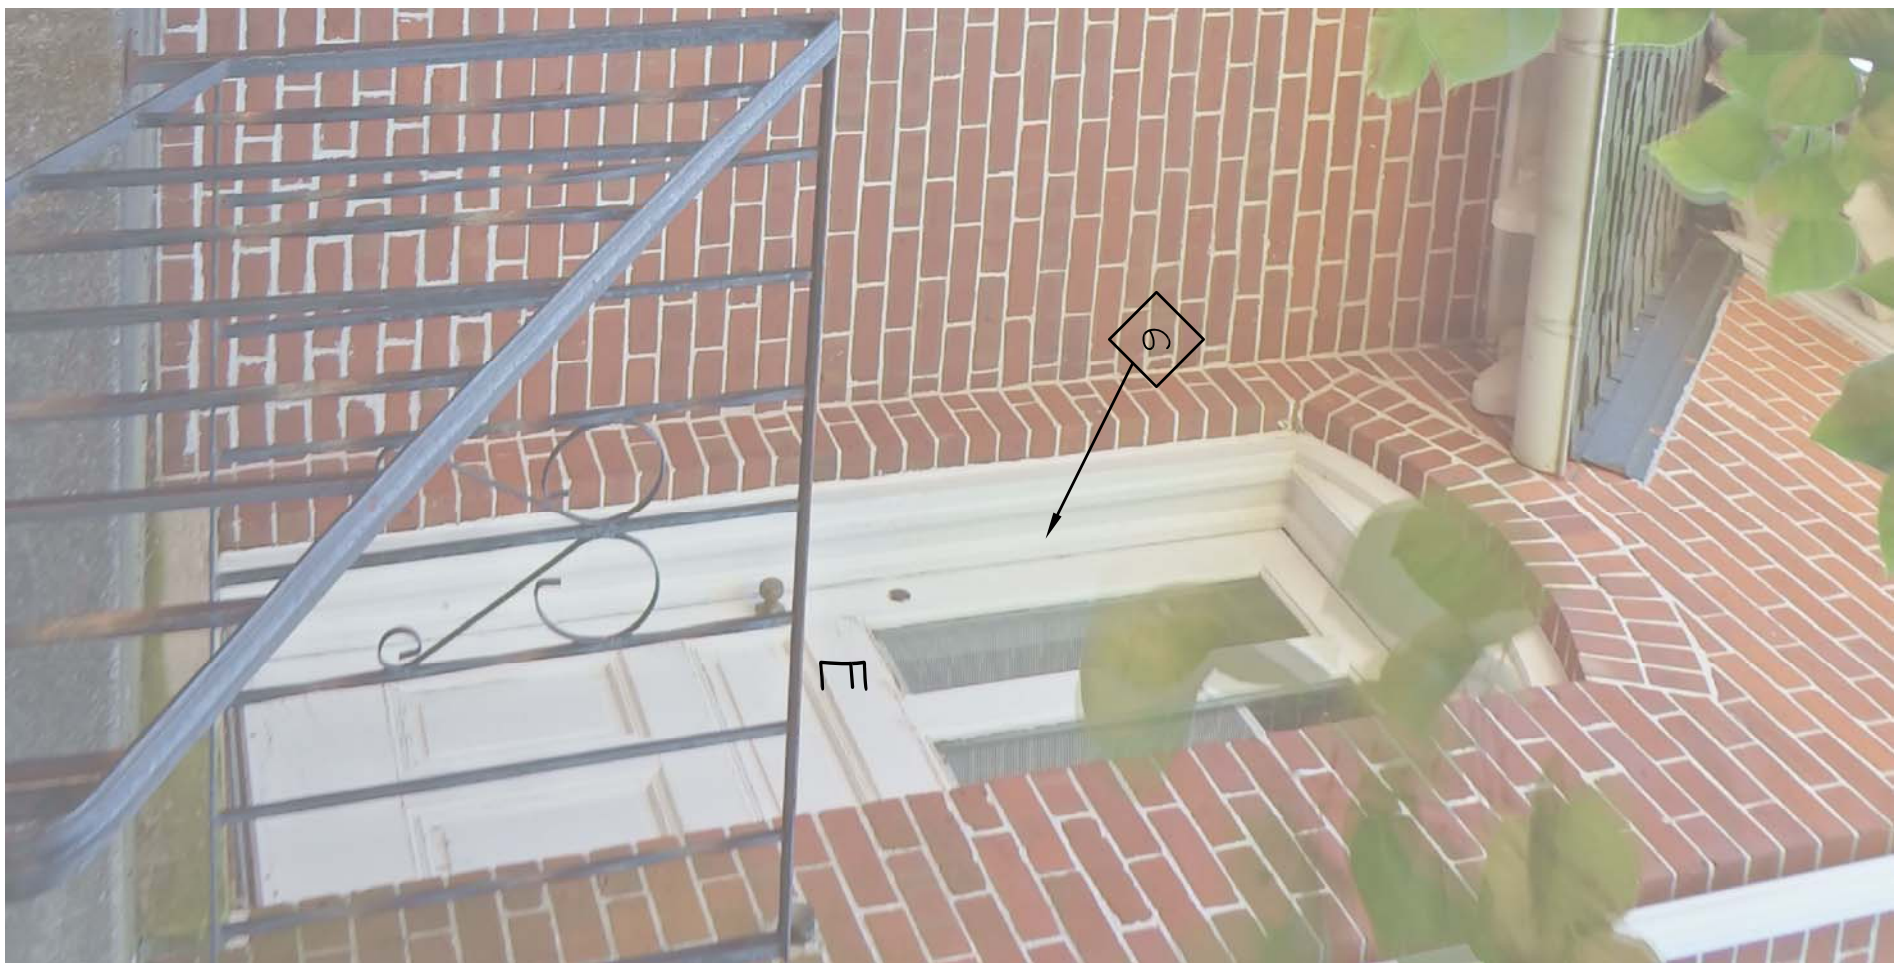


10 NORTH ELEVATION PHOTO
N.T.S.




8 NORTH ELEVATION PHOTO
N.T.S.




9 NORTH ELEVATION PHOTO
N.T.S.

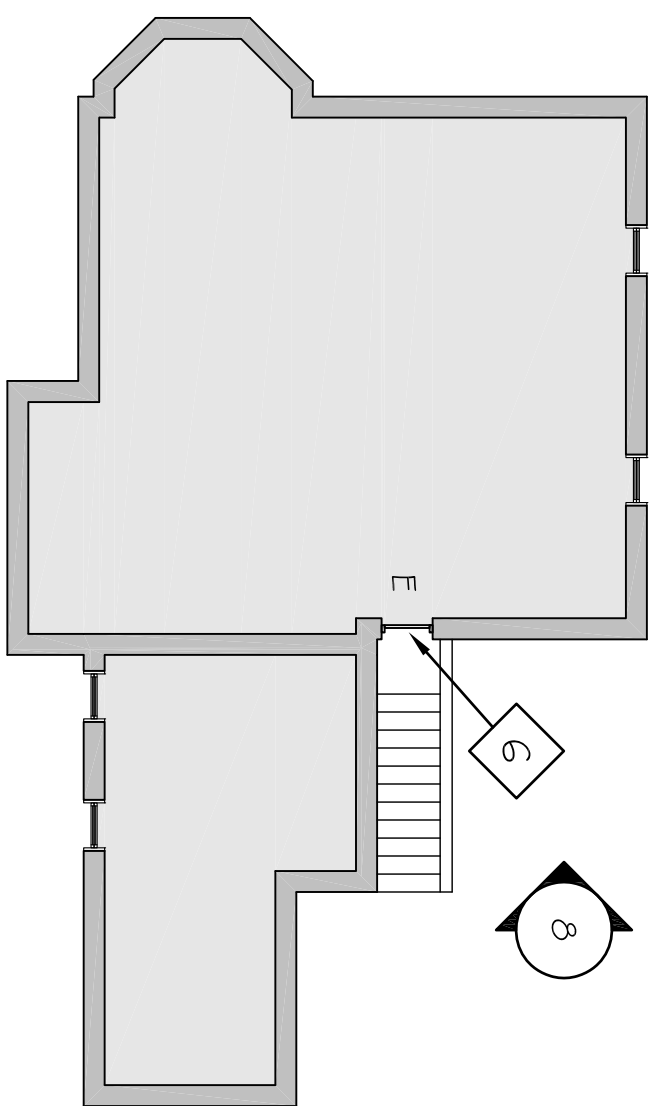


BASEMENT FLOOR PLAN
SCALE: 3/32" = 1'-0"
NORTH

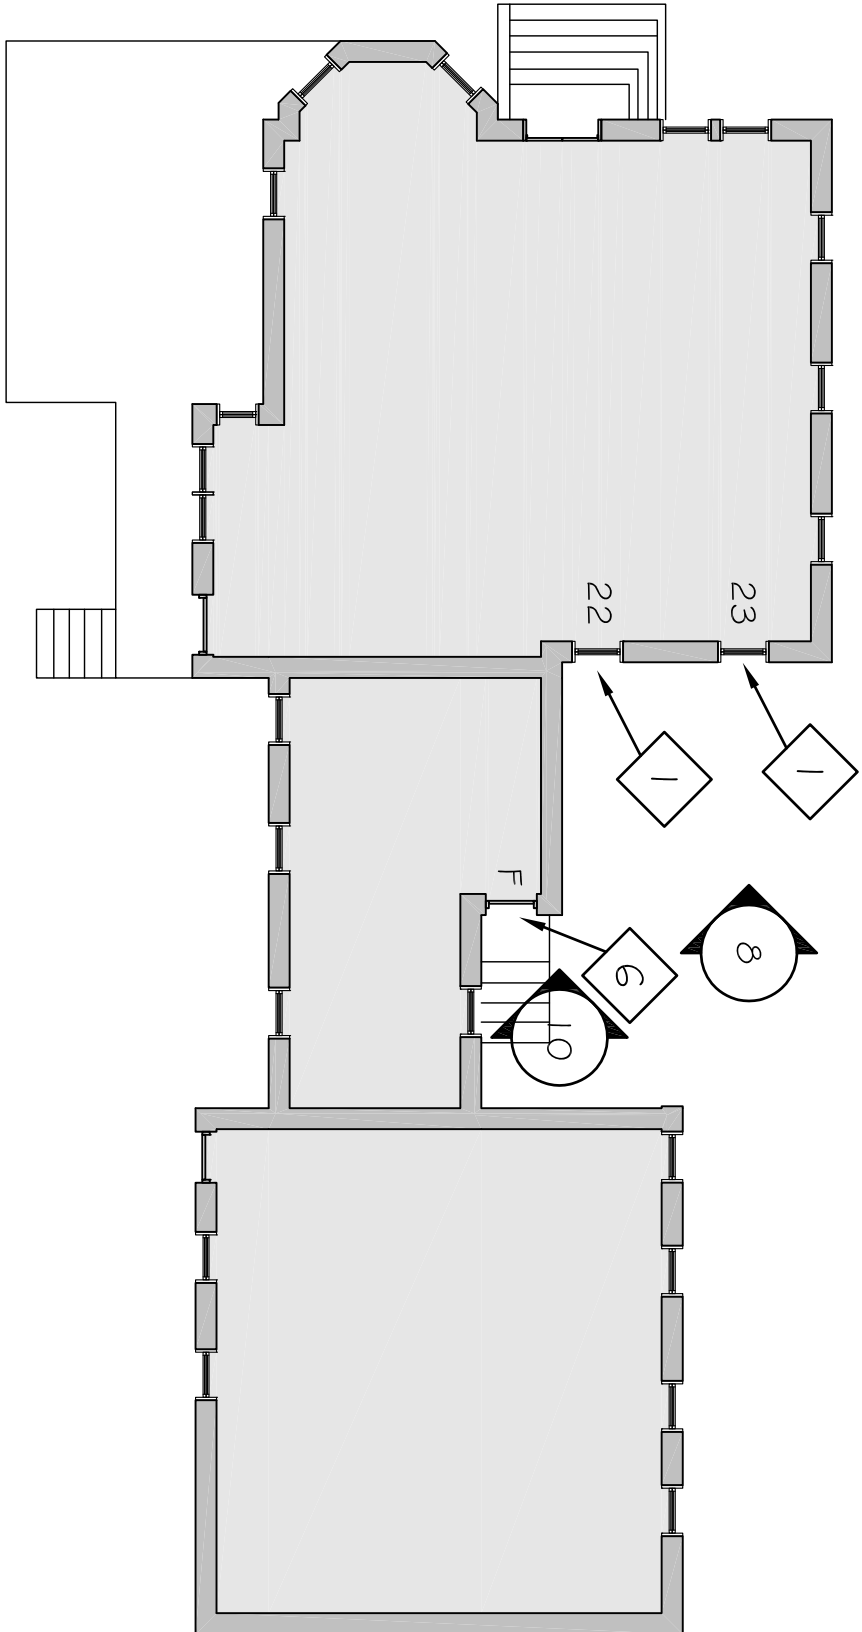

FIRST FLOOR PLAN
SCALE: 3/32" = 1'-0"
NORTH

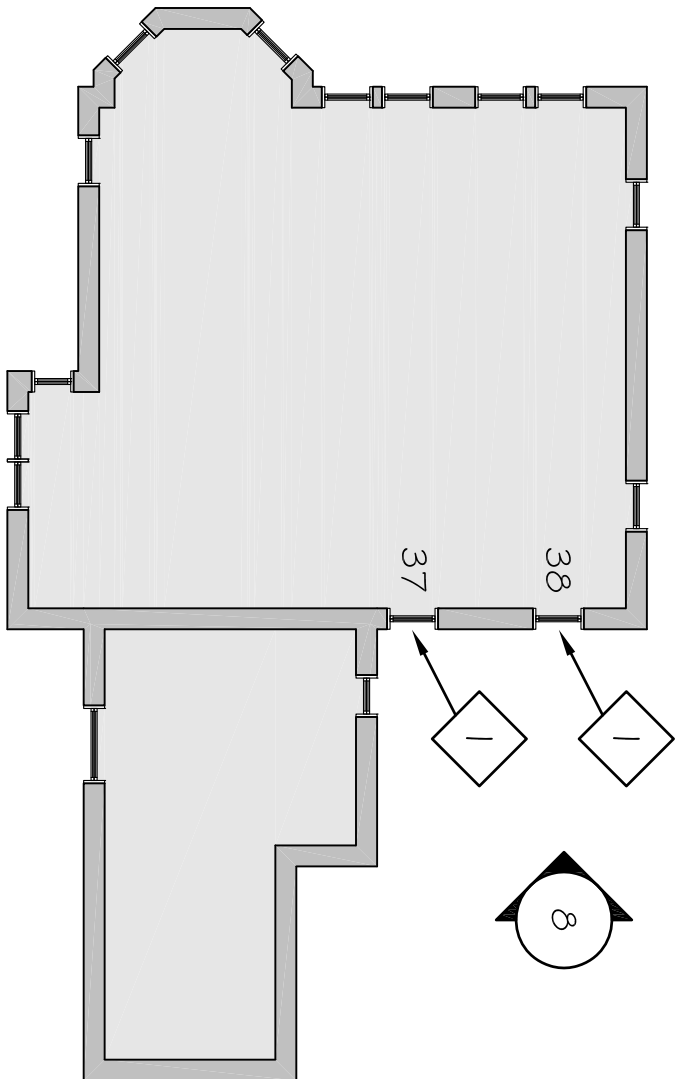

SECOND FLOOR PLAN
SCALE: 3/32" = 1'-0"
NORTH

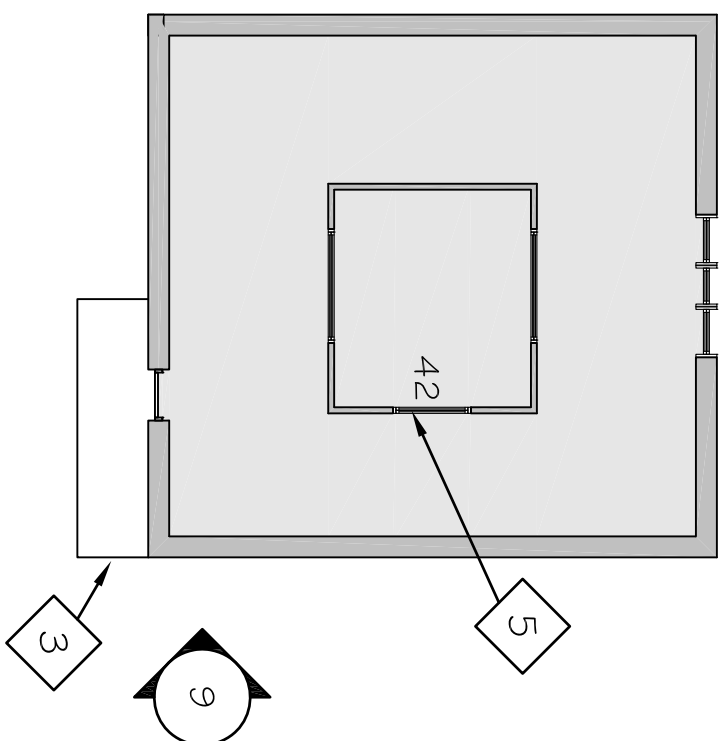

THIRD FLOOR PLAN
SCALE: 3/32" = 1'-0"
NORTH



THIS IS AN ORIGINAL DESIGN, CREATED BY SRKM ARCHITECTURE, INC. IT IS SUBMITTED FOR USE IN THIS PROJECT AND IS UNDER THE DOMINION AND CONTROL OF THE ARCHITECT. ANY OTHER USE OR REPRODUCTION OF THIS INFORMATION WITHOUT THE WRITTEN CONSENT OF SRKM ARCHITECTURE, INC. IS PROHIBITED. INDIANA, 02/25 BURLING WALKER, N. 45360

REVISION:

NORTH WINDOW REHABILITATION
WESTCHESTER TOWNSHIP MUSEUM
700 W PORTER, CHESTERTON, IN