
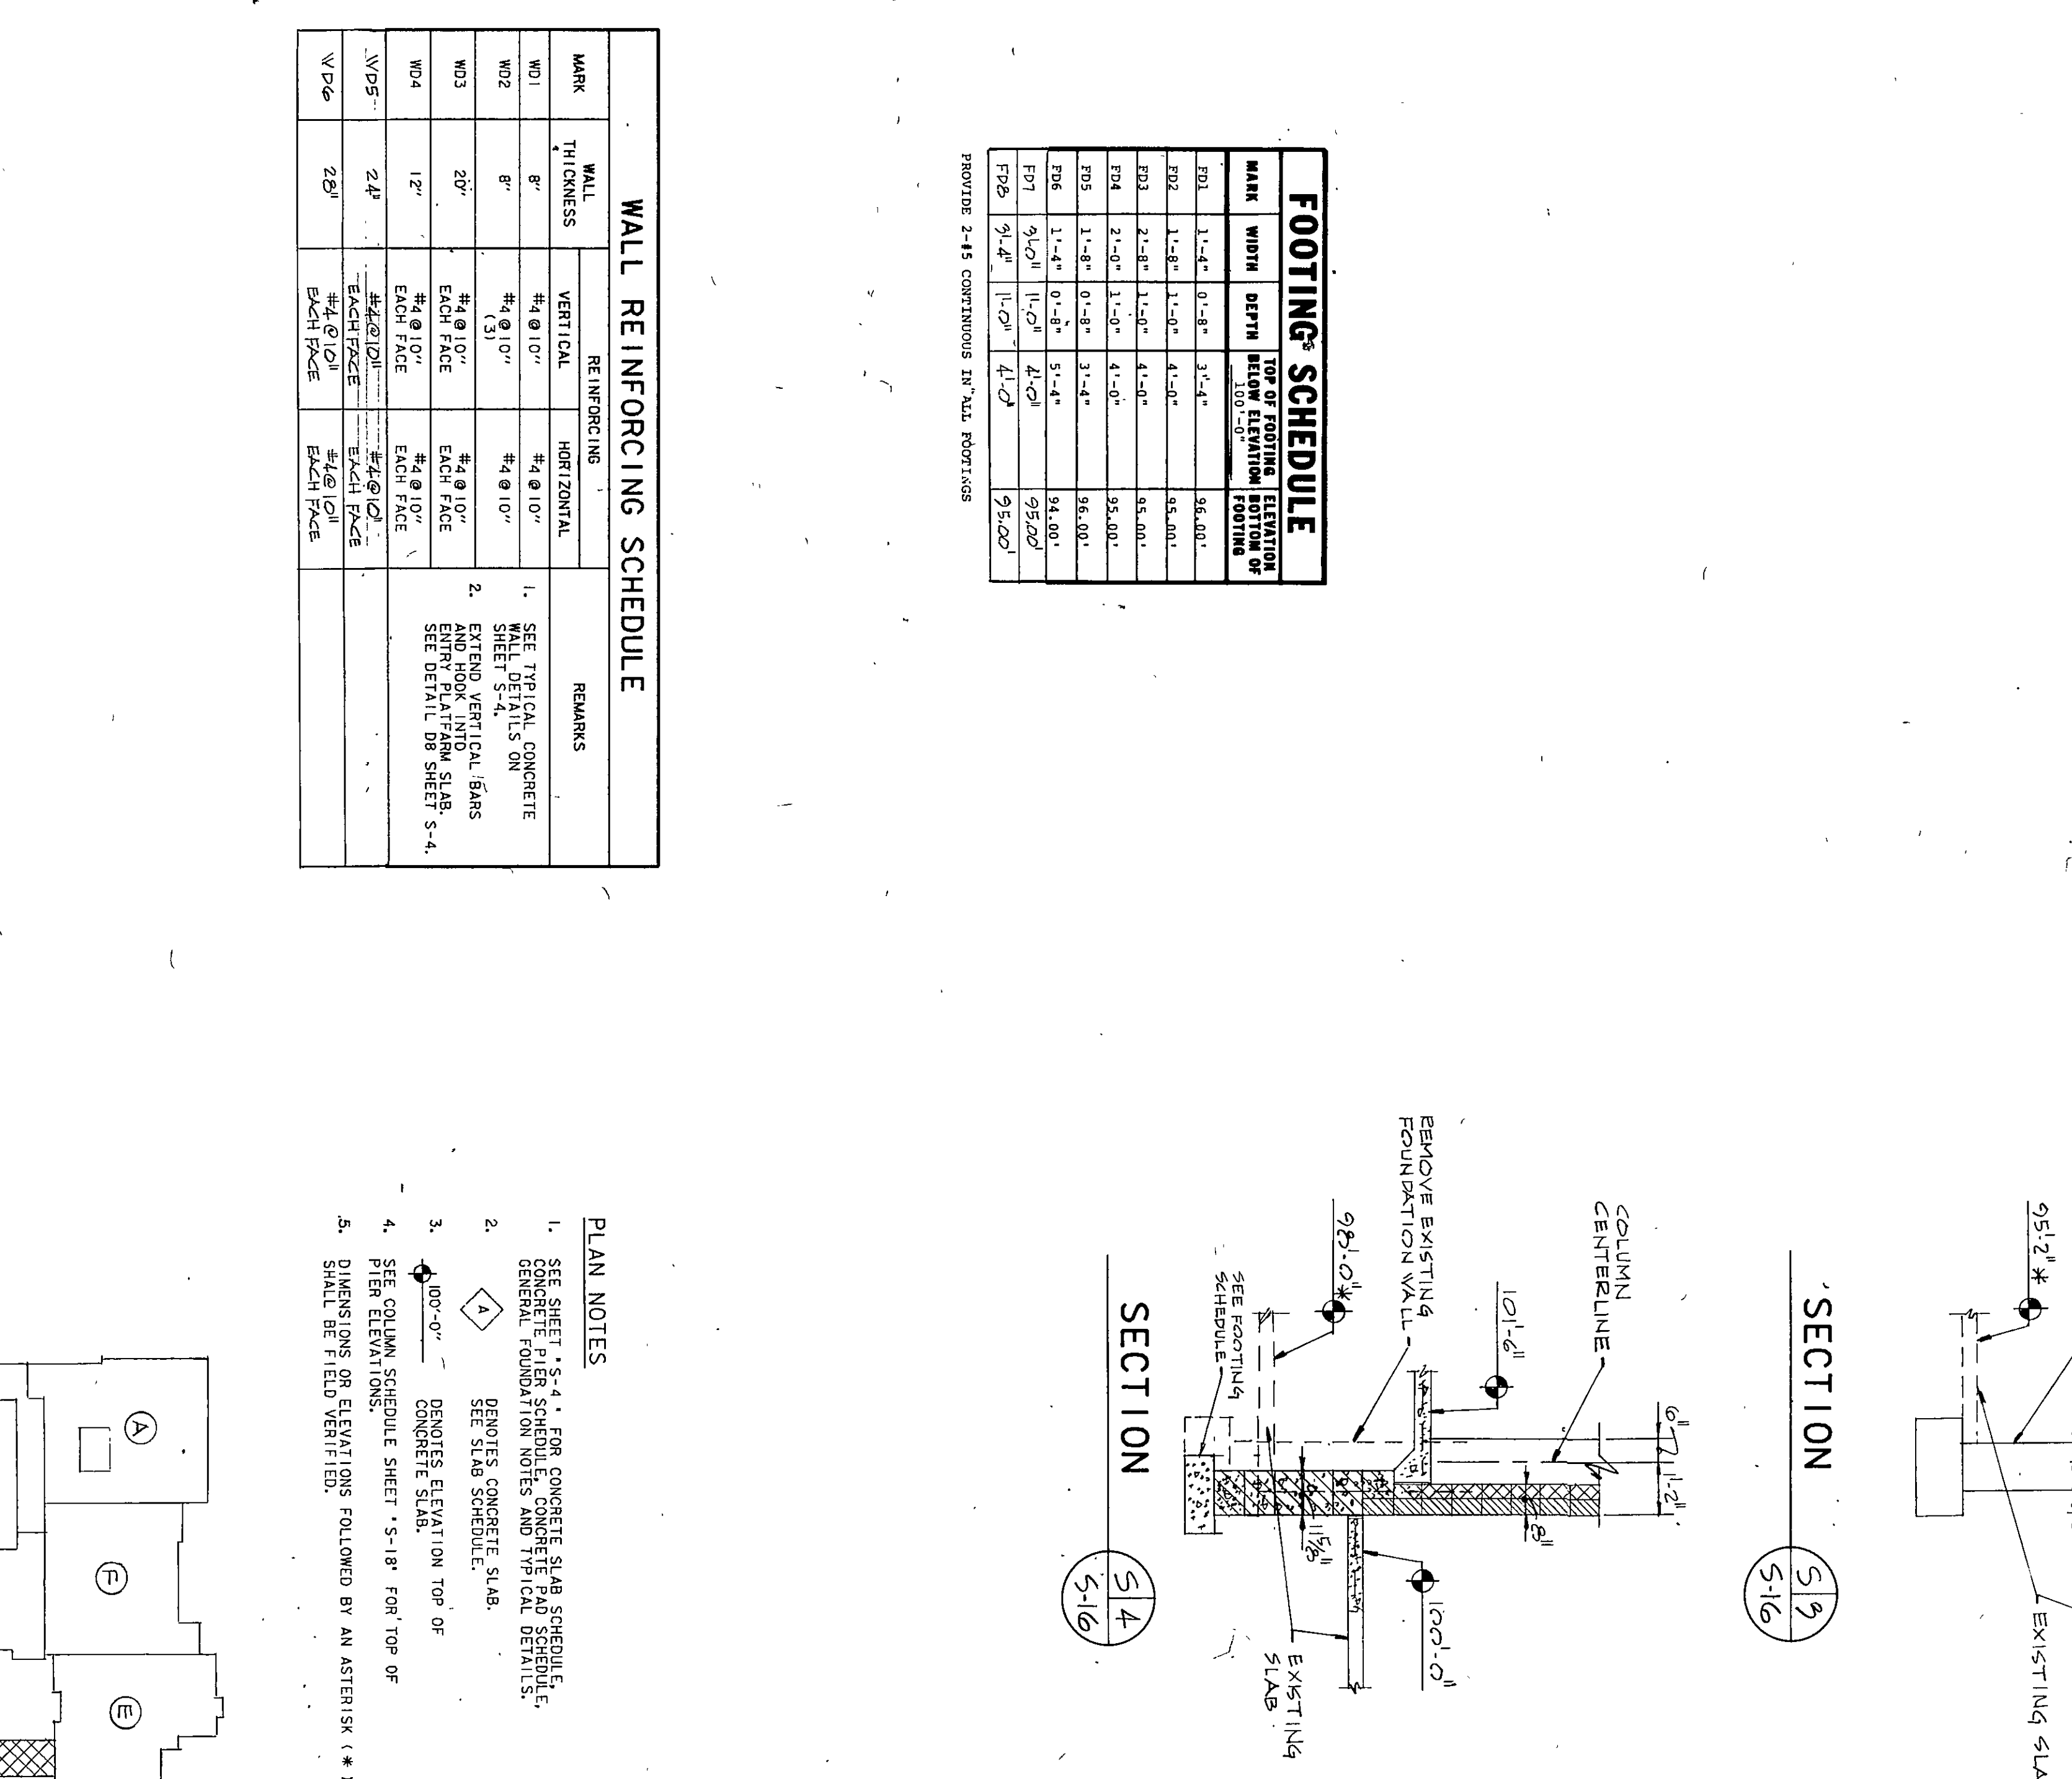
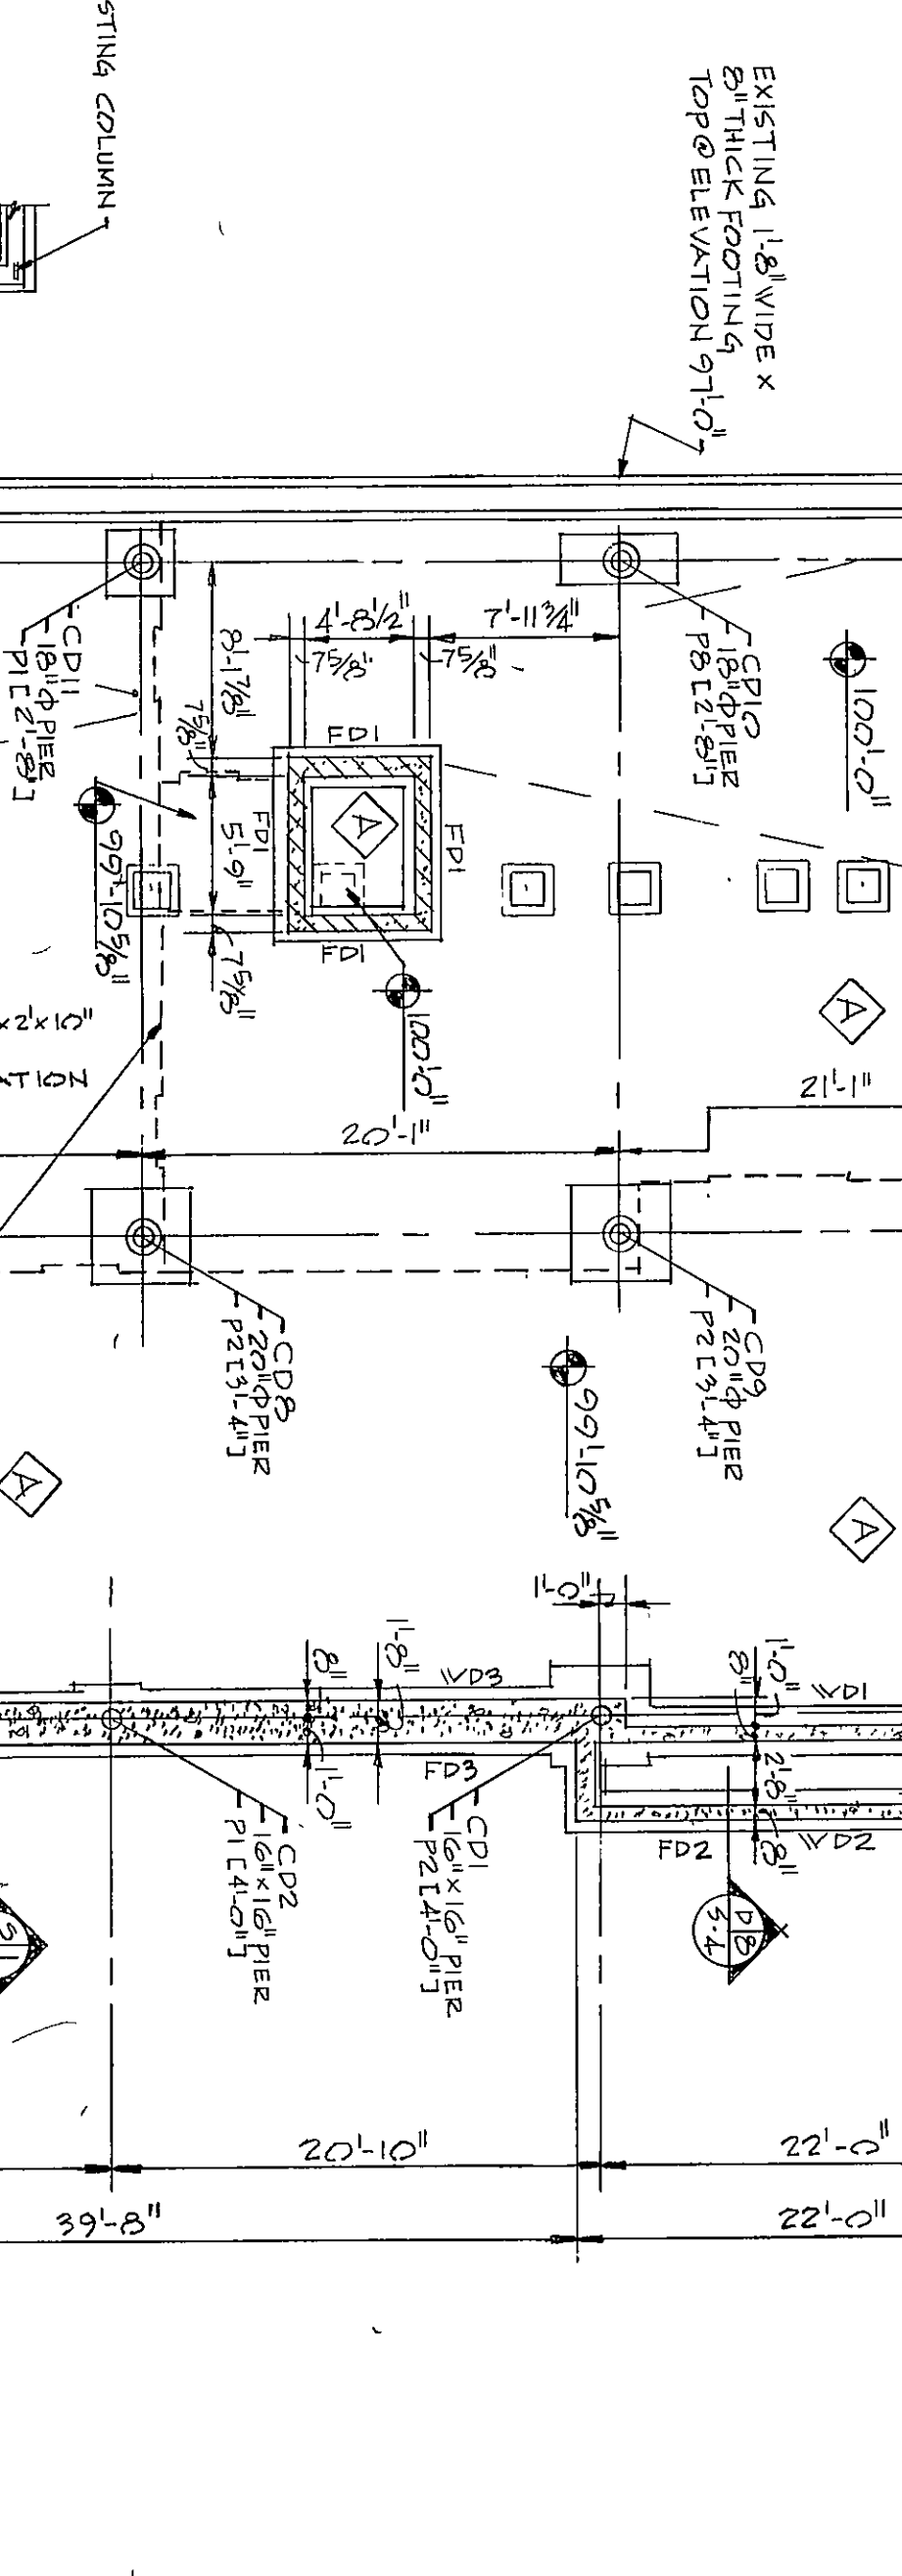
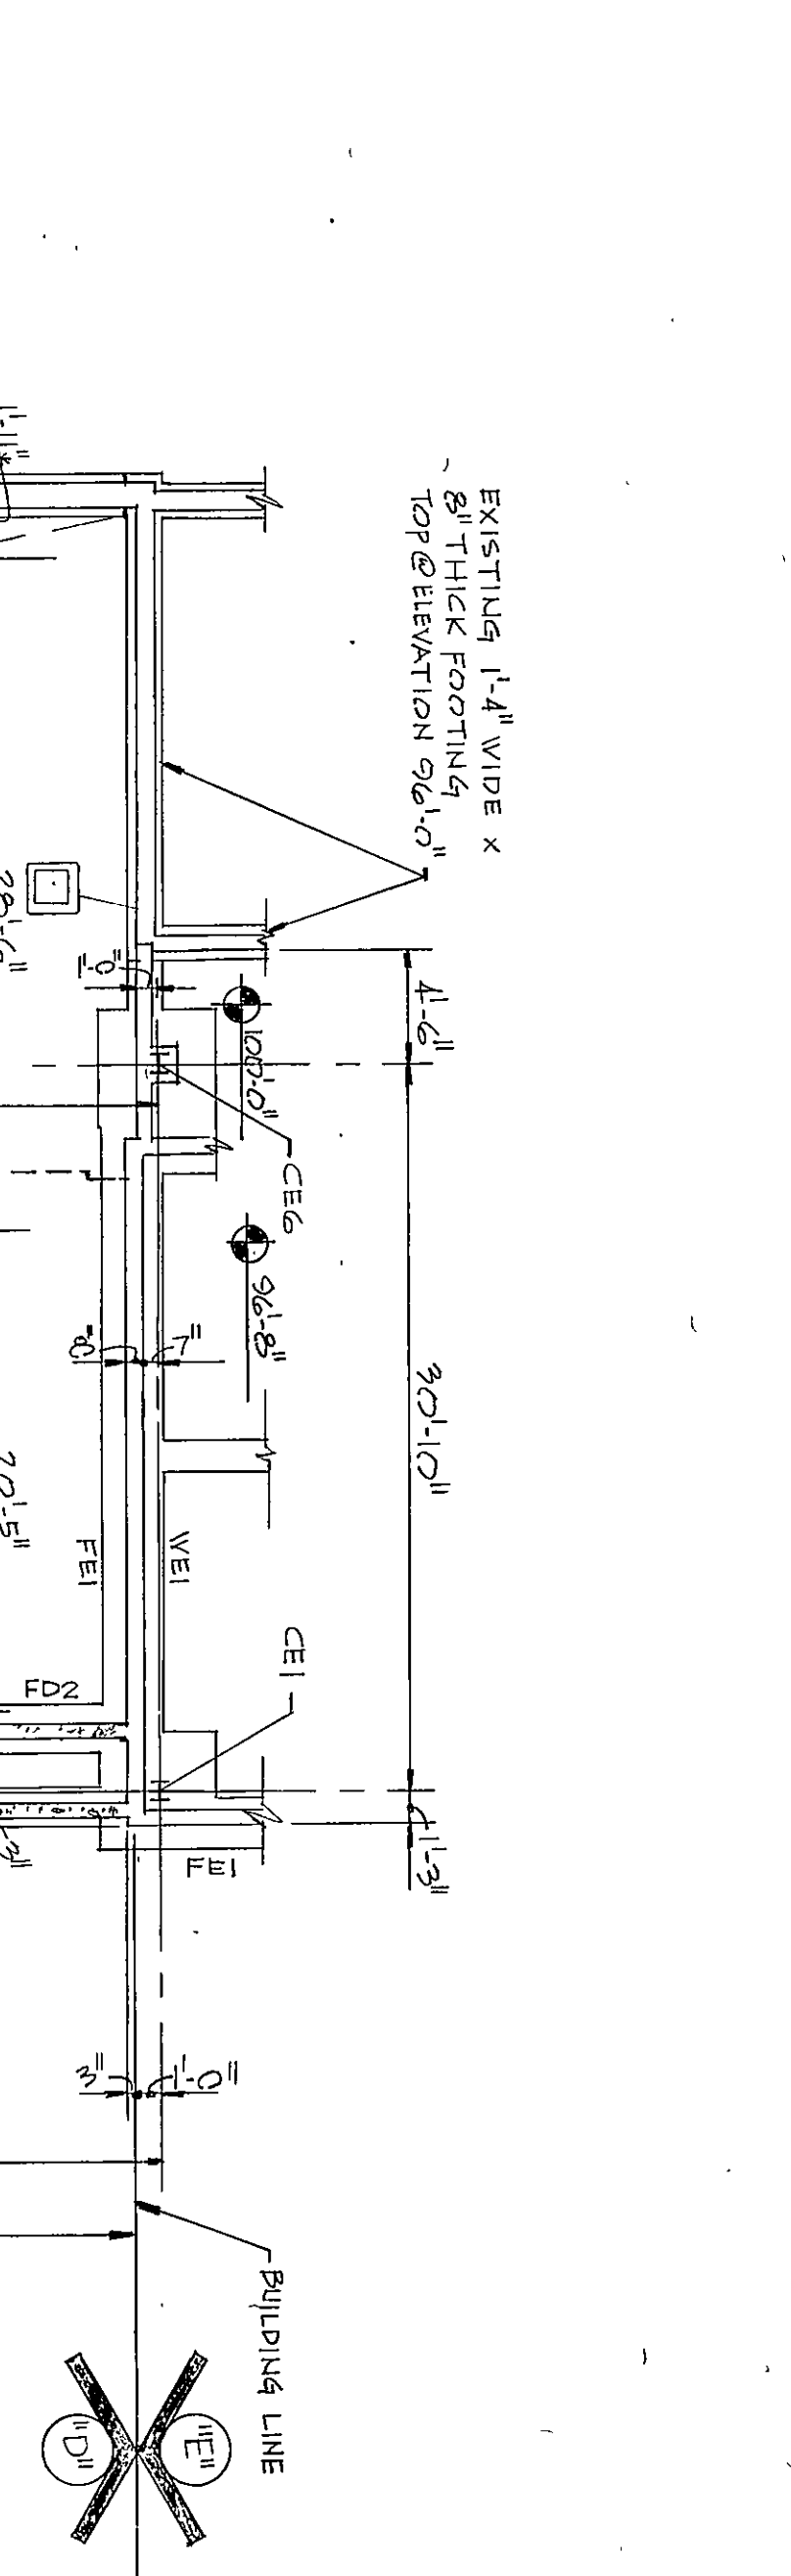
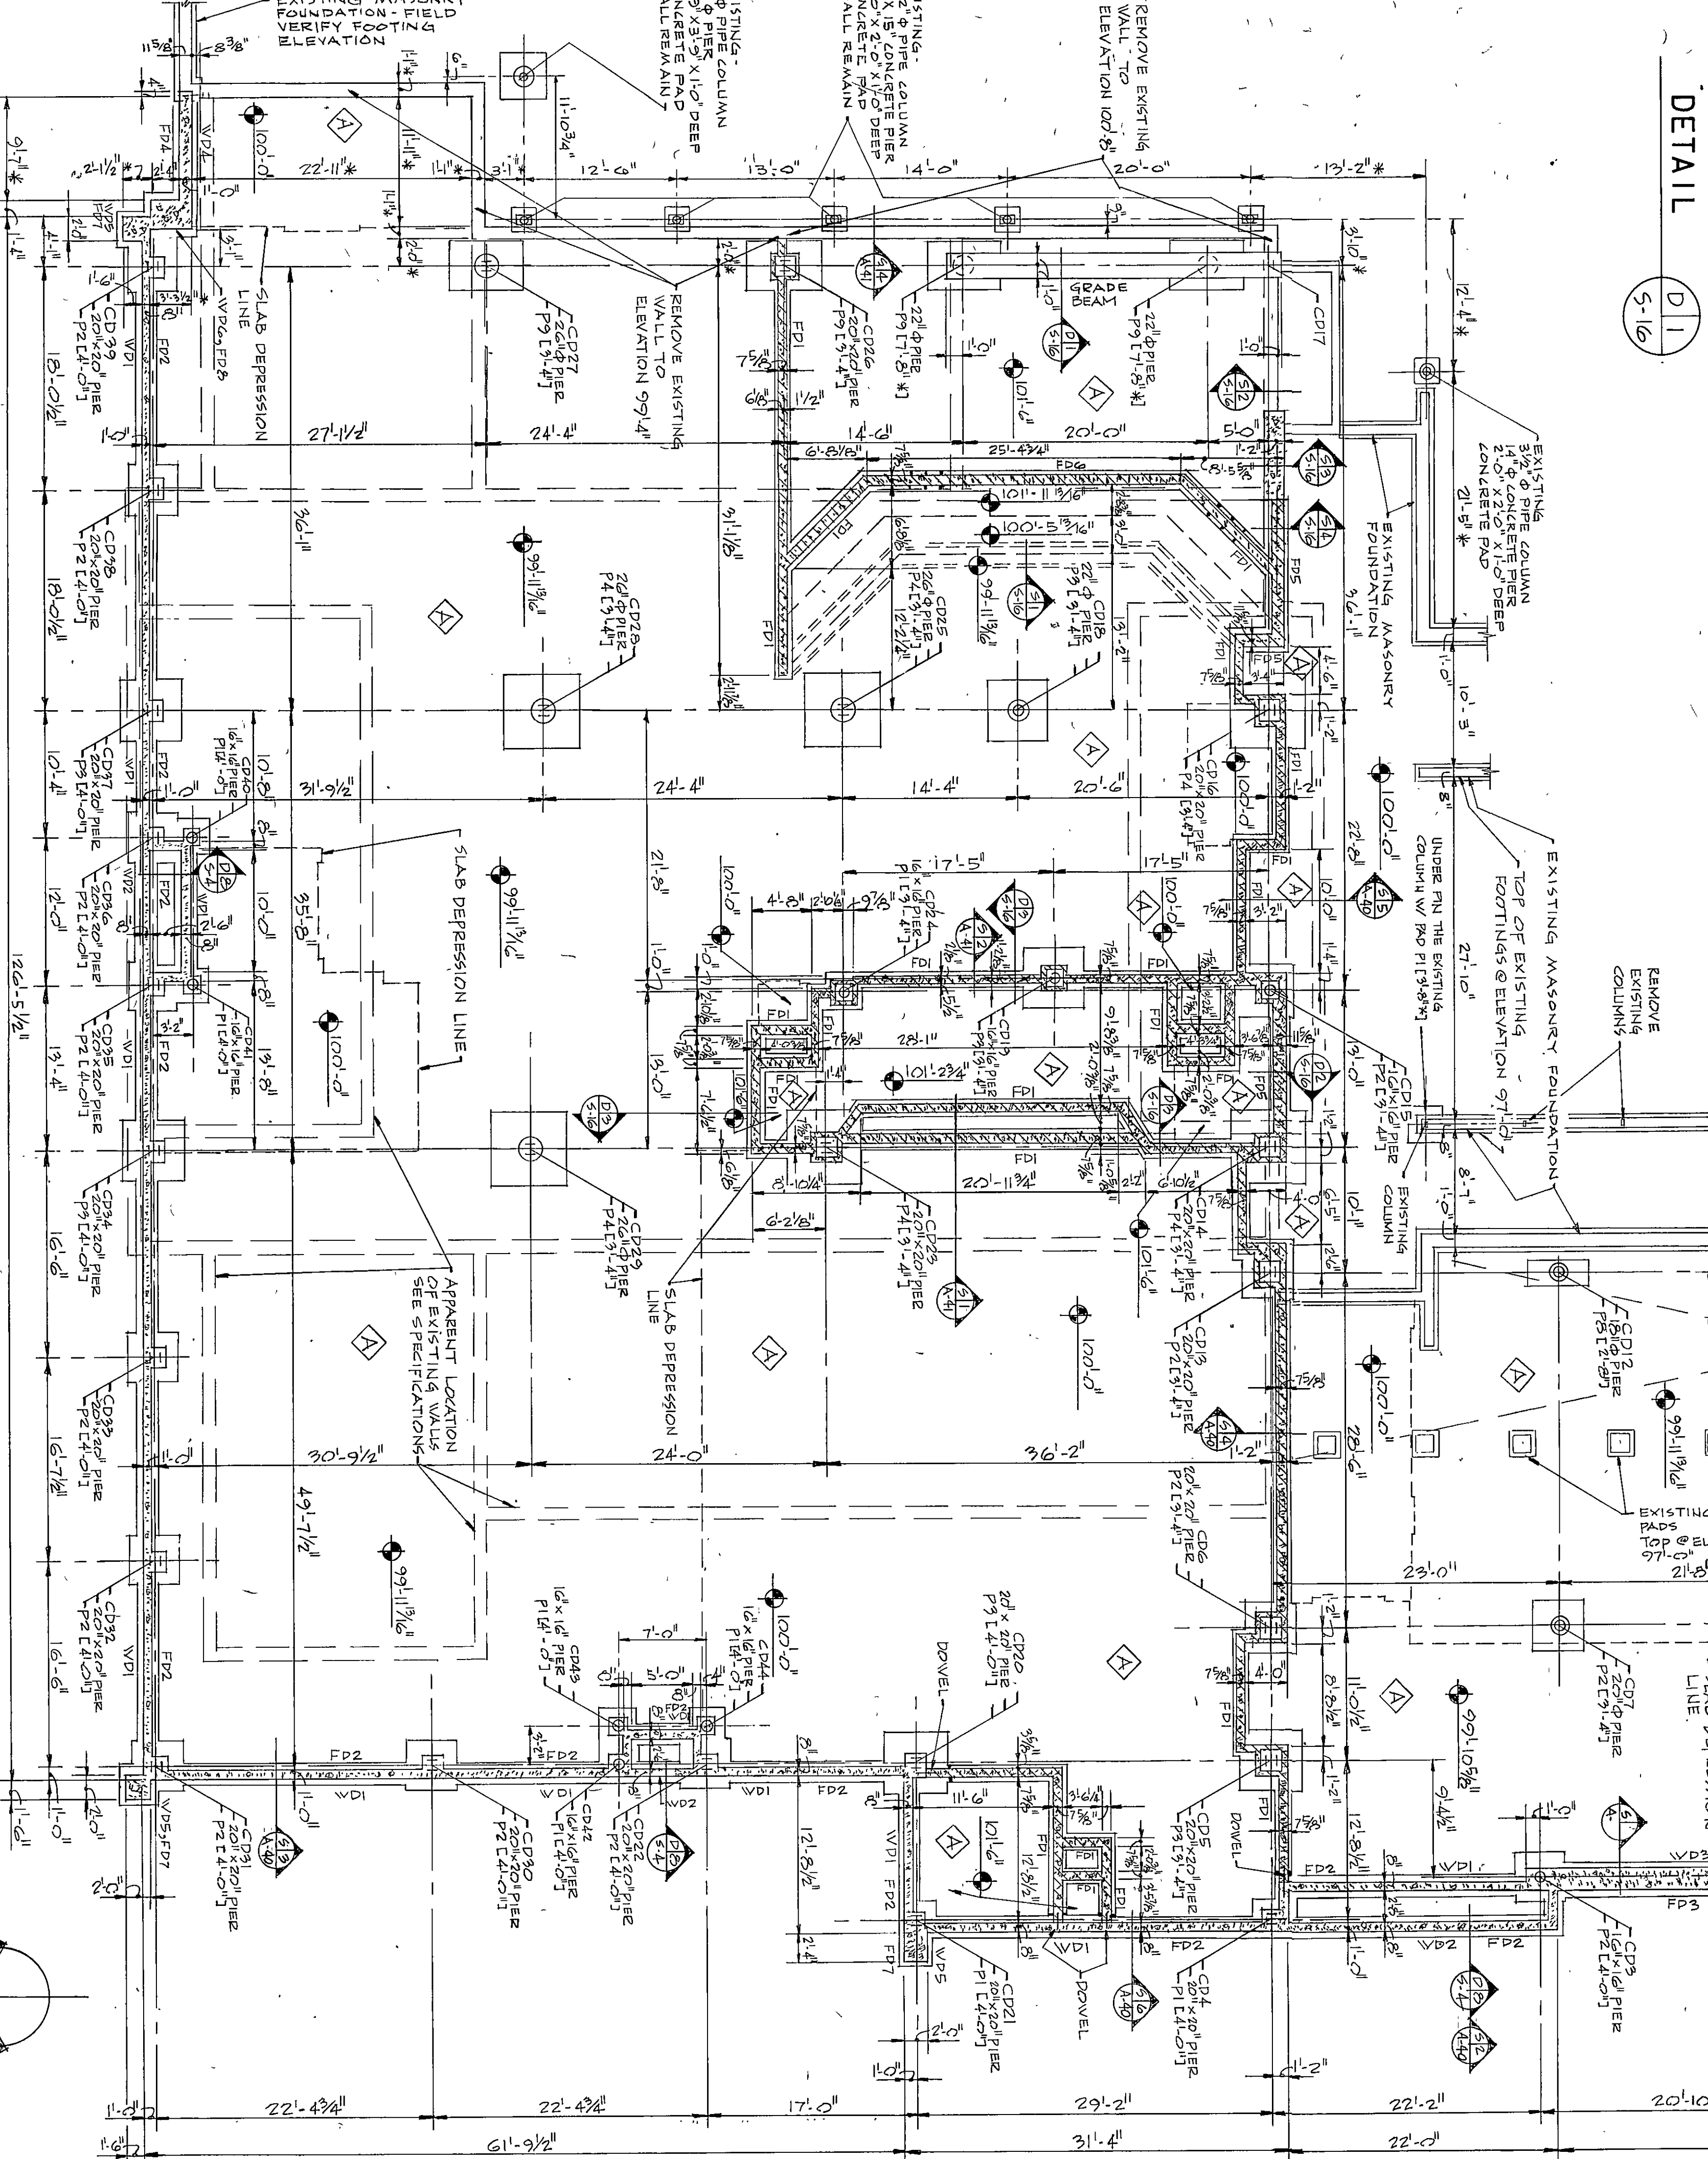
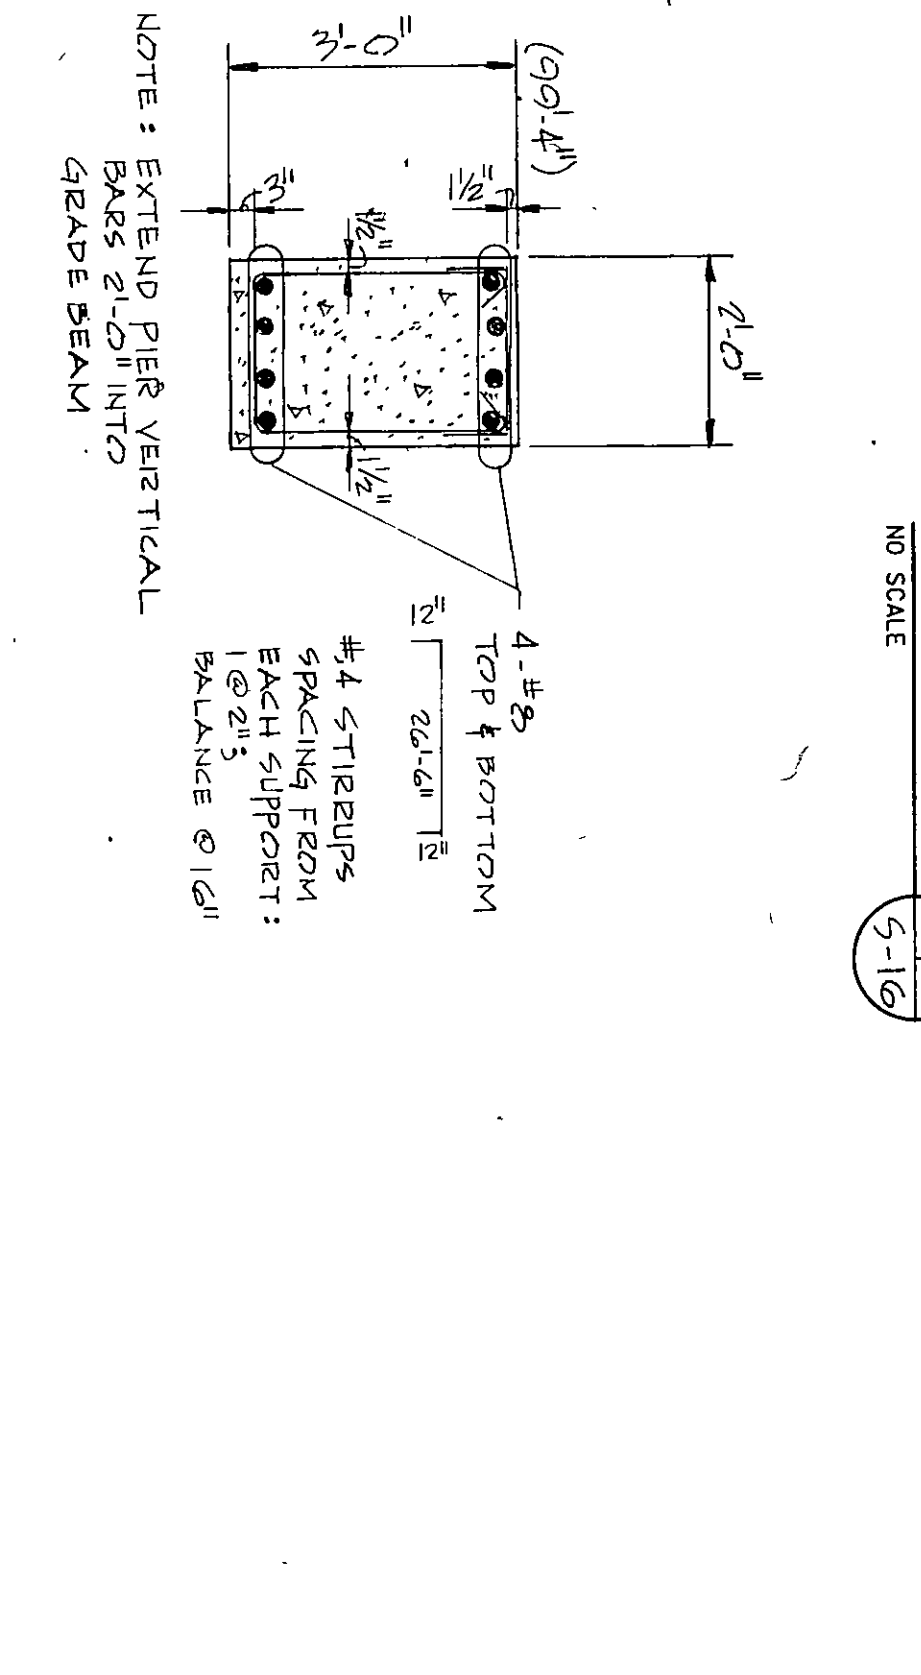


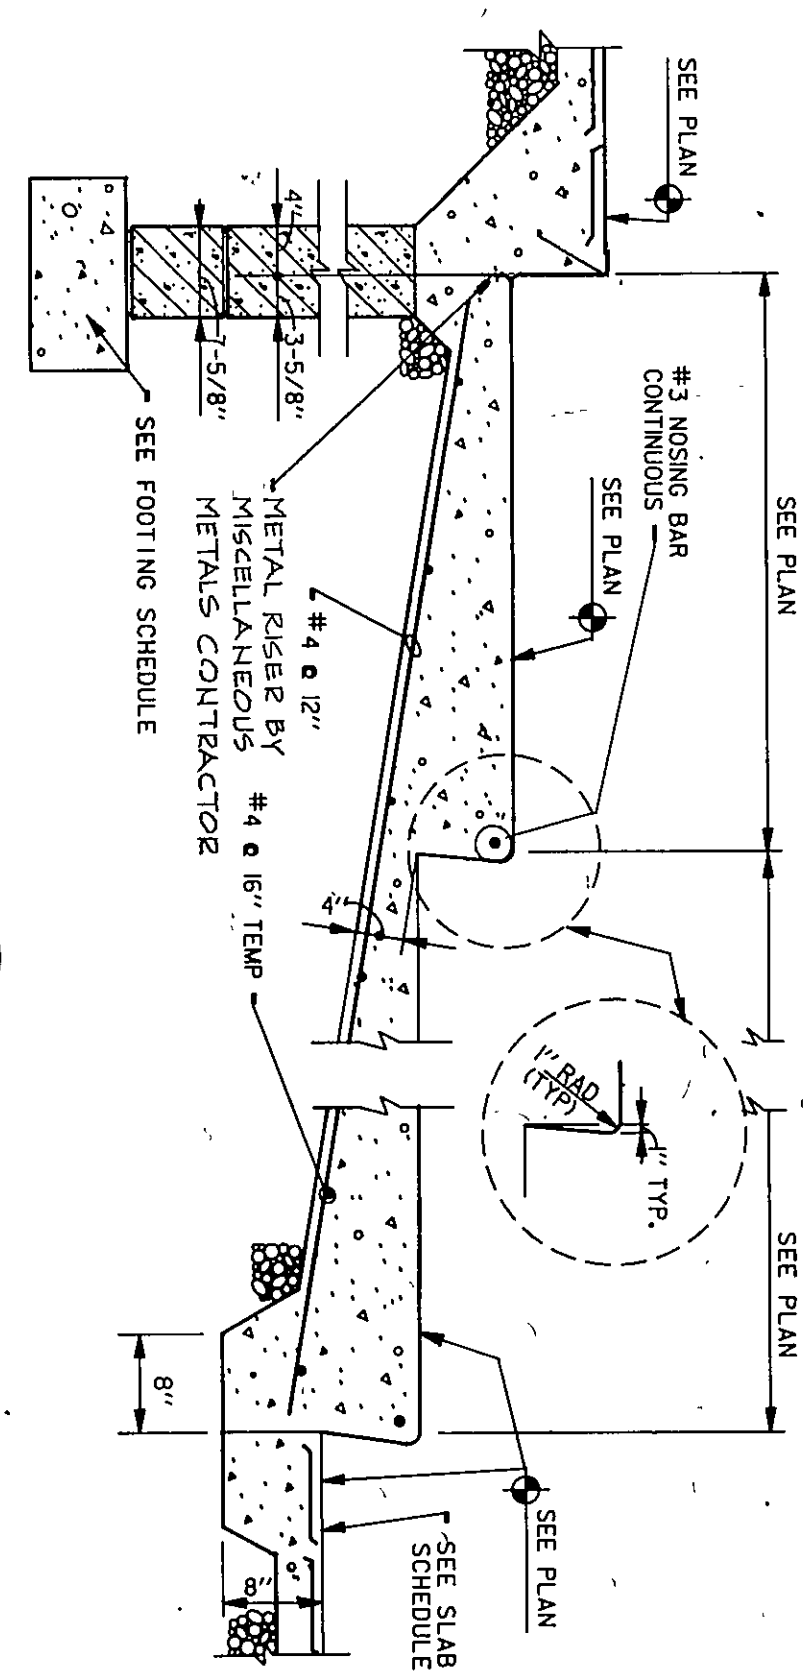

PROJECT
12579.00

DATE
MAY 3, 1982

REVISED

NO. S-16

OF 20

MARK	WIDTH	DEPTH	TOP OF FOOTING	BOTTOM OF FOOTING	REINFORCING
D0	1'-4"	0'-8"	3'-4"	2'-8"	#4 @ 10"
D1	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D2	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D3	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D4	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D5	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D6	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D7	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D8	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D9	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D10	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D11	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D12	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D13	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D14	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D15	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D16	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D17	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D18	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D19	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"
D20	1'-4"	1'-0"	4'-0"	3'-0"	#4 @ 10"

MARK	THICKNESS	VERTICAL	HORIZONTAL	REINFORCING	REMARKS
W01	8"	#4 @ 10"	#4 @ 10"	#4 @ 10"	1. SEE TYPICAL CONCRETE SCHEDULE SHEET S-1/1 ON GENERAL FOUNDATIONS AND TYPICAL DETAILS. 2. EXTEND VERTICAL BARS INTO PLATFIRM SLAB SEE DETAIL D0 S-1/4.
W02	8"	#4 @ 10"	#4 @ 10"	#4 @ 10"	
W03	20"	#4 @ 10"	#4 @ 10"	#4 @ 10"	
W04	12"	#4 @ 10"	#4 @ 10"	#4 @ 10"	
W05	24"	#4 @ 10"	#4 @ 10"	#4 @ 10"	
W06	28"	#4 @ 10"	#4 @ 10"	#4 @ 10"	

- PLAN NOTES
- SEE SHEET S-1/4 FOR CONCRETE SCHEDULE, GENERAL FOUNDATIONS AND TYPICAL DETAILS.
 - EXTEND VERTICAL BARS INTO PLATFIRM SLAB SEE DETAIL D0 S-1/4.
 - CONCRETE SCHEDULE SHEET S-1/18 FOR TOP OF PIER ELEVATIONS.
 - PIER ELEVATIONS FOLLOWED BY AN APOSTROPH (*).
 - SHALL BE FIELD VERTICAL.

EVERETT · I · BROWN COMPANY

5500 WEST BRADBURY AVENUE ·

ADDITION TO AND RENOVATION OF LIBERTY MIDDLE SCHOOL

ARCHITECTS
ENGINEERS

• INDIANAPOLIS, INDIANA • 46241